
2024

PRODUCT APPLICATIONS





ADAPT SOLUTIONS 01/04/2024

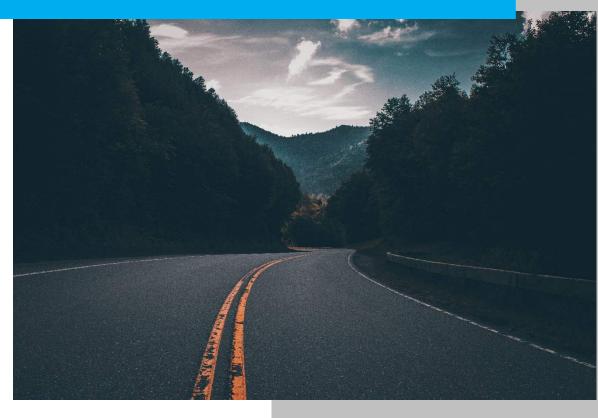

2024 PRODUCT APPLICATIONS

CLICK HERE FOR ADAPT SOLUTIONS PRODUCT OVERVIEW VIDEO

SEARCH BY PRODUCT: Click on the **PICTURE** for the overview page. Click on the **VEHICLE LIST** for the 'Quick Reference' page. Once you find the vehicle application you are looking for, click on it to reach the detailed application information.

























SEARCH BY MAKE / MODEL: Click on a **BRAND** to reach a list of vehicle models. Click on the **PRODUCT NAME** to reach the detailed application information. *Click on BACK at the bottom of any page to return here.*

Need Assistance? CHAT WITH US





























CHRYSLER APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Caravan / Town & Country / Voyager	1996 - 2000				✓
Voyager - Both wheelbases	1991 - 2003			√ WITH HI-LIFT	
Caravan / Town & Country - Both wheelbases	1991 - 2004		√ FRONT	√ WITH HI-LIFT	√
Caravan / Town & Country*- Stow 'N Go	2005 - 2007		√ FRONT	√* (driver only)	✓
Caravan / Town & Country - Without Stow 'N Go	2005 - 2007		√ FRONT	√ WITH HI-LIFT	✓
Caravan / Town & Country - Short wheelbase	2001 - 2007		✓ CENTER	√ WITH HI-LIFT	√
Caravan / Town & Country - Long wheelbase	2001 - 2007		✓ CENTER	√ WITH HI-LIFT	√
Caravan / Town & Country - Swivel 'N Go	2008 - 2011			√ WITH HI-LIFT	
Caravan / Town & Country* - Stow 'N Go	2005 - 2020		✓ CENTER	√ WITH HI-LIFT	√
Caravan / Town & Country*	2008 - 2020	✓ DRIVER* /PASSENGER ✓ 2 nd ROW	√ FRONT	√ WITH HI-LIFT	√
Grand Caravan*	2021 - 2024	✓ DRIVER/PASSENGER ✓ 2 nd ROW		√ ASENTO	√ *
Pacifica*	2017 - 2024	✓ DRIVER/PASSENGER ✓ 2 nd ROW		√ ASENTO	√ *
Voyager*	2020 - 2024	✓ DRIVER/PASSENGER ✓ 2 nd ROW		√ ASENTO	√ *
Dakota Club Cab	1997 - 2011			✓	
Dakota Quad Cab - 4 door	1997 - 2011			✓	
Durango	2004 - 2009			✓	
Journey	2008 - 2020	√* PASSENGER			
Ram Extended Cab/Quad Cab - Suicide door	1998 - 2002			✓	
Ram Reg Cab - 2 door	2002 - 2008			✓	
Ram Quad Cab - 4 door	2002 - 2008			✓	
Ram Mega Cab - 4 large doors	2006 - 2008			✓	
Ram Quad Cab / Crew Cab CLASSIC- 4 door	2009 - 2018	√ PASSENGER		✓	
Ram 2500/3500 Crew Cab/Mega Cab- 4 door	2010 - 2018	√ PASSENGER		✓	
Ram 2500/3500 Crew Cab* - 4 door	2019 - 2024	√ PASSENGER		NOT AVAILABLE	
Ram 1500 Quad Cab - 4 door*	2019 - 2024	√ DRIVER*/PASSENGER		✓ ASENTO	
Ram 1500 Crew Cab - 4 door*	2019 - 2024	DRIVER */PASSENGER DRIVER */PASSENGER		✓ ASENTO	



CHRYSLER APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Jeep Compass / Patriot	2007 - 2016			✓	
Jeep Gladiator	2020 - 2024	√ DRIVER / PASSENGER			
Jeep Grand Cherokee*	2011 - 2022	√* PASSENGER			
Jeep Wrangler - 4 door	2007 - 2018			√ *	
Jeep Wrangler - 4 door	2018 - 2024	√* DRIVER / PASSENGER			

^{*}Town & Country discontinued in 2016.

^{*}Caravan 2008-2020 - LINK: Steering column **must be telescopic**.

^{*}Chrysler Pacifica PINNACLE 2021 & up - SPEEDY-LIFT & LINK: NOT AVAILABLE for mid-row

^{*}Voyager 2020-2024 - **SPEEDY-LIFT**: **NOT AVAILABLE** PASSENGER side model with bench seat & **NOT AVAILABLE** 8 passengers LXi model.

^{*}Grand Caravan 2021-2024 - SPEEDY-LIFT: NOT AVAILABLE PASSENGER side model with bench seat & NOT AVAILABLE 8 passengers LXi model.

^{*}Jeep Grand Cherokee 2011-2022 NOT AVAILABLE for model with MANUAL SEATS & NOT AVAILABLE for WL Platform.

^{*}Jeep Wrangler - 4 door 2018-2024 - LINK: NOT AVAILABLE for JK model (2018).

^{*}Jeep Wrangler - 4 door 2007-2018 - XL-SEAT: NOT AVAILABLE for JL model (2018).

^{*}Journey 2008–2020 - LINK: ONLY AVAILABLE for model with SEAT STORAGE

^{*}Ram 1500 Crew/Quad 2019-2024: NOT AVAILABLE for RAM CLASSIC - 2018 model.



FORD APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Windstar - Without power seat	1995 - 1999		√ FRONT / CENTER	✓	
Windstar - Without power seat	1999 - 2003		√ FRONT / CENTER	√ WITH HI-LIFT	✓
Freestar / Monterey - Power seat	2004 - 2007		√ FRONT / CENTER	√ WITH HI-LIFT	✓
Freestar / Monterey - Without power seat	2004 - 2007		√ FRONT / CENTER	√ WITH HI-LIFT	✓
Mark LT - 4 door	2006 - 2008			✓	
F-150 Reg Cab - 2 door	2004 - 2008			✓	
F-150 Reg Cab - 2 door (small suicide door)	2009 - 2010			✓	
F-150 Super Cab - Suicide door	2004 - 2008			✓	
F-150 Super Crew Cab - 4 door	2004 - 2008			✓	
F-150 Super Cab* - Suicide door	2009 - 2014	√ DRIVER / PASSENGER		√ *	
F-150 Super Crew Cab - 4 door	2009 - 2014	√ DRIVER / PASSENGER		✓	
F-150 Super Cab – Suicide door	2015 - 2020	DRIVER / PASSENGER		✓	
F-150 Super Crew Cab – 4 door	2015 - 2020	DRIVER / PASSENGER		✓	
F-150 Super Cab – Suicide door	2021 - 2024	√ DRIVER / PASSENGER			
F-150 Super Crew Cab – 4 door	2021 - 2024	√ DRIVER / PASSENGER		✓	
F-150 Raptor Super Cab - Suicide door	2011 - 2016	√ DRIVER / PASSENGER		✓	
F-150 Raptor Super Crew Cab - 4 door	2011 - 2016	√ DRIVER / PASSENGER		✓	
F-150 Raptor Super Cab - Suicide door	2017 - 2024	DRIVER / PASSENGER		✓	
F-150 Raptor Super Crew Cab - 4 door	2017 - 2024	DRIVER / PASSENGER		✓	
F-250, F-350, F-450 Super Cab - Suicide door	2008 - 2010			✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2008 - 2010			✓	
F-250, F-350, F-450 Super Cab - Suicide door	2011 - 2016	DRIVER / PASSENGER		✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2011 - 2016	√ DRIVER / PASSENGER		✓	
F-250, F-350, F-450 Super Cab - Suicide door	2017 - 2024	√ DRIVER / PASSENGER		✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2017 - 2024	√ DRIVER / PASSENGER		✓	
Ranger Super Crew Cab - 4 door	2019 - 2023	√ * PASSENGER		√ ASENTO	

^{*} Ford F-150 Super Cab - NOT AVAILABLE for model with ONLY 2 DOORS.

^{*} Ranger Super Crew Cap - **NOT AVAILABLE** for models with **POWER SEAT**



FORD APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Explorer	2011 - 2015	√ PASSENGER		✓	
Explorer	2016 - 2019	√ PASSENGER		✓	
Explorer	2020 - 2024	* √ DRIVER / PASSENGER		*√	
Escape	2013 - 2019	√ PASSENGER			
Expedition / Navigator	2007 - 2017	√ PASSENGER			
Expedition* / Navigator*	2018 - 2024	*✓ DRIVER/PASSENGER *✓ 2 nd ROW		√* ASENTO	
Edge	2011 - 2014			✓	
Edge	2015 - 2024	√ PASSENGER		√ ASENTO	
Lincoln MKX	2016 - 2018	√ PASSENGER		√ ASENTO	
Lincoln Nautilus	2019 - 2023	√ PASSENGER		√ ASENTO	

^{*2018-2024} Ford Expedition FRONT- LINK: NOT AVAILABLE for model with MANUAL SEAT.

^{*2018-2024} Lincoln Navigator FRONT- LINK: NOT AVAILABLE for model with PERFECT POSITION SEAT.

^{*2018-2024} Ford Expedition & Lincoln Navigator 2ND ROW - LINK: AVAILABLE ONLY for LONG WHEELBASE model (Navigator L & Expedition MAX)

^{*2018-2024} Ford Expedition - ASENTO: NOT AVAILABLE for model with PERFECT POSITION SEAT or model with MANUAL SEAT

^{*2020-2024} Ford Explorer - ASENTO & LINK: NOT AVAILABLE for model with MANUAL SEAT



GENERAL MOTORS APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Astro / Safari	1995 - 2005		√ FRONT		
Montana / Silhouette / Transport / Venture	1997 - 2004		√ FRONT / CENTER	√ WITH HI-LIFT	✓
SV6 / Terraza / Uplander / Venture / Relay	2005 - 2009		FRONT / CENTER	√ WITH HI-LIFT	✓
Avalanche	2007 - 2013	√ DRIVER / PASSENGER		✓	
Canyon / Colorado Extended Cab - Suicide door	2004 - 2012			✓	
Canyon / Colorado Extended Cab*- Suicide door	2015 - 2022	√ DRIVER*/ PASSENGER*		√ ASENTO	
Canyon / Colorado Crew Cab*- 4 door	2015 - 2022	√ DRIVER*/ PASSENGER		✓ ASENTO	
Sierra / Silverado Regular Cab-1500- 2 door	1999 - 2013			✓	
Sierra / Silverado Extended Cab-1500- No suicide door	1999 - 2002			✓	
Sierra / Silverado Extended Cab-1500- Suicide door	2001 - 2006			✓	
Sierra / Silverado Extended Cab-1500- Suicide door	2007 - 2013	√ DRIVER / PASSENGER		✓	
Sierra / Silverado Double Cab-1500- 4 door (2 smaller)	2014 - 2018	√ DRIVER / PASSENGER		✓ ASENTO	
Sierra / Silverado Crew Cab-1500- 4 door	2007 - 2013	√ DRIVER / PASSENGER		√	
Sierra / Silverado Crew Cab-1500- 4 door	2014 - 2018	√ DRIVER / PASSENGER		✓ ASENTO	
Sierra / Silverado Crew Cab-1500- 4 door	2019 - 2024	√ DRIVER / PASSENGER		✓ ASENTO	
Sierra / Silverado Double Cab-1500- 4 door (2 smaller)	2019 - 2024	√ DRIVER / PASSENGER		✓ ASENTO	
Sierra / Silverado HD -2500 / 3500- All models	2007 - 2014	√ DRIVER / PASSENGER		✓	
Sierra / Silverado HD -2500 / 3500- All models	2015 - 2024	√ DRIVER / PASSENGER		✓ ASENTO	
Escalade / Suburban / Tahoe / Yukon - All models	2007 - 2014	√ DRIVER / PASSENGER		✓	
Escalade / Suburban / Tahoe / Yukon - All models	2015 - 2020	√ DRIVER / PASSENGER		✓ ASENTO	
Escalade / Suburban / Tahoe / Yukon - All models	2021 - 2024	√ DRIVER / PASSENGER		✓ ASENTO	
Blazer	2019 - 2024	√ DRIVER / PASSENGER*		✓ ★ ASENTO	

^{*2015–2022} **Canyon / Colorado Ext Cab** - LINK: Rear door must be opened for operation.

 $^{{\}bf *2015\text{--}2022}~\textbf{Canyon / Colorado Crew Cab} - LINK: Steering column \ must be \ telescopic.$

^{*2019-2024} Blazer - ASENTO & LINK: NOT AVAILABLE for ELECTRIC MODEL (BLAZER EV)



GENERAL MOTORS APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Acadia *(See note on Limited)	2008 - 2016	√ PASSENGER			
Acadia	2017 - 2023	√ DRIVER / PASSENGER		√ ASENTO	
Cadillac XT6	2020 - 2024	DRIVER / PASSENGER			
Enclave*	2008 - 2017	√ PASSENGER			
Enclave*	2018 - 2024	√ * DRIVER / PASSENGER & 2 nd ROW		√ ASENTO	
Terrain / Equinox	2010 - 2017	√ PASSENGER			
Terrain / Equinox	2018 - 2024	√ DRIVER / PASSENGER		√ ASENTO	
Traverse*	2008 - 2017	√ PASSENGER			
Traverse*	2018 - 2023	√ * DRIVER / PASSENGER & 2 nd ROW		√ ASENTO	

^{*}GMC Acadia Limited 2017 is the 2008-2016 body style.

^{*}Traverse 2018-2023 - LINK: NOT AVAILABLE in driver position for model with manual seat. | 2nd Row, NOT AVAILABLE for 8 passenger model.



HONDA APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Odyssey	1999 - 2004			√ WITH HI-LIFT	✓
Odyssey	2005 - 2010		✓ CENTER	√ WITH HI-LIFT	✓
Odyssey	2011 - 2017		FRONT / CENTER	✓	✓
Odyssey	2018 - 2024	√2 nd ROW		√ ASENTO	✓



HYUNDAI APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Entourage	2006 - 2009		✓ CENTER	✓	✓
Palisade	2020 - 2024	√ DRIVER*/ PASSENGER*		√ *	

^{*}Palisade 2020-2024 - **ASENTO: NOT AVAILABLE** for model with manual seat.

^{*}Enclave 2018-2024 - LINK: NOT AVAILABLE in driver position for model with manual seat. | 2nd Row, NOT AVAILABLE for 8 passenger model.

^{*}Palisade 2020-2024 - LINK: NOT AVAILABLE for models with MANUAL SEATS



KIA APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Carnival*	2022 - 2024	√ FRONT* / CENTER*		√ ∗	√ *
Sedona	1999 - 2005		FRONT / CENTER	✓	✓
Sedona	2006 - 2012	√2 nd ROW	✓ CENTER	√ WITH HI-LIFT	✓
Sedona	2012 - 2014	√2 nd ROW			✓
Sedona*	2015 - 2021	√ PASSENGER & 2 nd ROW*		✓	√ *
Telluride*	2020 - 2024	√ DRIVER*/ PASSENGER*		√ *	

^{*}Sedona 2015-2021 - NOT AVAILABLE for models with OEM footrest | Discontinued in Canada 2019-2020 model.

^{*}Telluride 2020-2024 - LINK NOT AVAILABLE for model with manual seat.



MAZDA APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Mazda 5 *	2006 - 2015				✓

^{*}discontinued in USA in 2015, discontinued in Canada in 2017



MERCEDES APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Metris	2016 - 2023			√ ASENTO	✓



NISSAN APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Quest	2011 - 2016			√ WITH HI-LIFT	✓
Ariya	2022 - 2024	√ DRIVER/PASSENGER*			

^{*}Ariya 2022-2024 – LINK FRONT PASSENGER: NOT AVAILABLE for models with POWER SEAT.

^{*}Carnival 2022-2024 - LINK: NOT AVAILABLE in driver position for model with manual seat

⁻ LINK CENTER: NOT AVAILABLE if equipped with power seat.

^{*}Carnival 2022-2024 - **SPEEDY-LIFT: NOT AVAILABLE** for 7 passenger model.

^{*}Carnival 2022-2024 - ASENTO: NOT AVAILABLE for model with manual seat.

^{*}Telluride 2020-2024 - **ASENTO: NOT AVAILABLE** for model with manual seat.



SUBARU APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Forester	2014 - 2018			√ ASENTO	



TESLA APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
X	2015 - 2020			√ ASENTO	*√ SPEEDY
X	2021 - 2024			√ ASENTO	*√ SPEEDY

^{*}Tesla X 2021-2024 - SPEEDY-LIFT: NOT AVAILABLE PASSENGER side model with bench seat.



TOYOTA APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Sienna	2004 - 2010		FRONT / CENTER	√ WITH HI-LIFT	✓
Sienna - Power seat	2005 - 2010		√ FRONT	√ WITH HI-LIFT	✓
Sienna*- 7 & 8 passenger	2011 - 2020	✓ DRIVER/PASSENGER ✓ 2 nd ROW*	✓ CENTER	√ WITH HI-LIFT	✓ *SEE NOTE
Sienna*- With footrest	2011 - 2020	✓ DRIVER/PASSENGER ✓ 2 nd ROW*	✓ CENTER	√ WITH HI-LIFT	✓
Sienna*- 7 & 8 passenger	2021 - 2024	✓ DRIVER/PASSENGER ✓ 2 nd ROW*		√ ASENTO	✓ *SEE NOTE
Tacoma Access Cab - Suicide door	2005 - 2015	√ PASSENGER		✓	
Tacoma Access Cab - Suicide door	2016 - 2023	√ PASSENGER		√ ASENTO	
Tacoma Double Cab - 4 reg. door	2005 - 2023	√ PASSENGER		✓	
Tundra Double Cab - 4 door (rear doors smaller)	2014 - 2021	√ DRIVER / PASSENGER		√ ASENTO	
Tundra Crew Max - 4 door	2014 - 2021	√ DRIVER / PASSENGER		√ ASENTO	
Tundra Crew Max – 4 door	2022 - 2024	√ DRIVER / PASSENGER			
4 Runner	2003 - 2024			✓	
Rav 4	2006 - 2012			✓	
Rav 4*	2013 - 2018	√ PASSENGER		√ *	
Rav 4*	2019 - 2024	√* PASSENGER		√ ASENTO	
Venza*	2008 - 2016	√* PASSENGER			
Highlander	2014 - 2019	√ PASSENGER		√ ASENTO	

^{*}Rav 4 2013-2018 - XL-SEAT: AVAILABLE FOR MANUAL SEATS ONLY

^{*}Venza 2008-2016 passenger side - LINK: AVAILABLE FOR MANUAL SEATS ONLY



VOLKSWAGEN APPLICATIONS

MODEL	YEAR	LINK	XL-BASE	XL-SEAT ASENTO	SPEEDY LIFT
Routan	2009 - 2012	✓ DRIVER/PASSENGER ✓ 2 nd ROW	FRONT / CENTER	√ WITH HI-LIFT	✓

^{*}Sienna 2011-2020 8 passenger - SPEEDY: Passenger side all mid-row seats will be removed

^{*}Sienna 2021-2024 8 passenger - SPEEDY: Passenger side all mid-row seats will be removed

^{*}Rav 4 2019-2024 - LINK: AVAILABLE FOR MANUAL SEATS ONLY

^{*}Sienna 8 passenger, 2nd row, driver side - LINK: **NOT AVAILABLE**

LINK





WEBSITE RESOURCES

Connect to the locked portion of the site.



HOW IT WORKS VIDEO

In just a few minutes, see all of the key features of the product.



PRODUCT VIDEO

Overview of the LINK in motion.



HIGHLIGHTS

- Only uses OEM seat
- All safety features retained
- Great comfort, legroom and space
- Seating behind LINK is not affected
- Customizable movements
- Compatible with 100s of vehicles
- 3 year warranty, 350 lbs capacity



THINGS TO REMEMBER

- The LINK uses the original seat; however, due to the many trim levels available for a
 given application, it is possible that some of the vehicle's original features will need
 to be cancelled or removed at the time of installation.
- Note that during the install, OEM wire harness is cut and extended under the seat to maintain the OEM security and comfort features. Installation also involves trim and/or shroud modification based on vehicle year, make and model.

LINK | REFERENCES



USER DELIVERY VIDEO

Learn how the pendant and seat adjustments work.



REDUCED POWER MODE.

If the vehicle battery dies or gets disconnected, the LINK protects itself with a reduced power mode.



REMOTE DIAGNOSTICS

The LINK is equipped with a remote diagnostic system that can be run over the phone with a technician.



Throughout this tool you will find references to assist you in evaluating the feasibility of a LINK in specific vehicles to meet your client's specific needs. In some applications, the seated position and/or the forward and aft travel of the seat changes with the LINK installed. Below is a visual aid to explain how these details are to be understood.

(OEM = Original Equipment Manufacturer. | Chrysler; GM, Toyota, etc. | from the factory)



MANUAL BACK UP VIDEO

In the unlikely event of an issue, the LINK is equipped with a manual back up.



This information will give an idea of the seat height with the LINK installed. Due to the various seat styles offered by vehicle manufacturers, the information is supplied as a reference to assist you in establishing if the seated height on the LINK will be suitable for your client. *Example:* In the 2015 Ford F-150 Super Cab – the note reads as follows:

"Seat height: ½ inch lower than OEM (nonadjustable manual seat)"

This means that in that model of Ford, with a manual seat (a seat that doesn't offer 'height' adjustment) the LINK will sit half an inch lower than it did before the installation.

(See visual aid - not to scale)



SEAT ADJUSTMENT



forward and back movements of the seat with the LINK. In all applications, the LINK adds power forward and backward movements, regardless of the seat's original functions. In some applications, the travel is limited. The seat adjustment information will allow you to confirm if the installation of the LINK will be suitable for your client's needs.

FRONT is to indicate towards the steering wheel or front of the vehicle.

BACK is to indicate towards the rear of the vehicle.





This information is so you can establish the estimated transfer height of the LINK in most vehicles.

As suspensions, tires and wheels can affect the exact height at which a vehicle sits, this method can allow you to evaluate more accurately the transfer height in your specific vehicle.

The LINK has two travel lengths, **SHORT**: for most minivans, SUV's and smaller vehicles; and LONG: for trucks and large SUV's. Please confirm the model in question, SHORT or LONG with our sales or service department.

(See visual aid - not to scale)



LINK QUICK REFERENCE

page 1 of 3

See next pages for more applications & additional notes

	1 0			
CHRYSLER		DRIVER	PASSENGER	2 nd ROW
Caravan / Town & Country (*T&C discontinued 2016)	2008 - 2020	√*	✓	✓
Grand Caravan	2021 - 2024	✓	✓	✓
Pacifica	2017 - 2024	✓	✓	√ *
Voyager	2020 - 2023	✓	✓	✓
Ram 1500 CLASSIC Crew Cab - 4 door	2009 - 2023		✓	
Ram 1500 Crew Cab - 4 door	2019 - 2024	√ *	✓	
Ram 1500 CLASSIC Quad Cab - 4 door	2009 - 2023		✓	
Ram 1500 Quad Cab - 4 door	2019 - 2024	√ *	✓	
Ram 2500/3500 - 4 door	2010 - 2018		✓	
Ram 2500/3500 - 4 door	2019 - 2024		✓	
Jeep Gladiator	2020 - 2024	✓	✓	
Jeep Grand Cherokee	2011 - 2022		√ *	
Jeep Wrangler – 4 door	2018 - 2024	√ *	√ *	
Journey	2008 - 2020		√ *	
FORD	2000 2020	DRIVER	PASSENGER	2 nd ROW
F-150 Super Cab - Suicide door	2009 - 2014	→ VER	√*	Z ROW
F-150 Super Crew Cab - 4 door	2009 - 2014	√	√ *	
F-150 Super Cab - Suicide door	2015 - 2020	√	√	
F-150 Super Crew Cab - 4 door	2015 - 2020	√	√	
F-150 Super Cab - Suicide door	2013 - 2020		√	
F-150 Super Crew Cab - 4 door	2021 - 2023	√	√	
Raptor Super Cab - Suicide door	2021 - 2024	√	√ *	
Raptor Super Crew Cab - 4 door	2011 - 2016	√	√ *	
Raptor Super Cab - Suicide door	2017 - 2016	√	→	
Raptor Super Crew Cab - 4 door	2017 - 2024	√		
F-250, F-350, F-450 Super Cab - Suicide door	2017 - 2024	<i>-</i>	· ✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2011 - 2016		· ✓	
F-250, F-350, F-450 Super Clew Cab - 4 door	2017 - 2016	<i>-</i>	· ✓	
F-250, F-350, F-450 Super Crew Cab - 4 door	2017 - 2024	<i>-</i>	· ✓	
Ranger Super Crew Cab - 4 Door	2017 - 2024		· ✓	
Explorer	2019 - 2024		· ✓	
Explorer	2016 - 2019		· ✓	
	2020 - 2024	√ *	/ *	
Explorer Expedition / Navigator		• • •	√	
Expedition / Navigator	2007 - 2017	√ *	√ *	√ *
Expedition / Navigator Escape	2018 - 2024 2013 - 2019	v	√	A
-			· ✓	
Edge Lincoln MKX	2015 - 2024 2016 - 2021		<u> </u>	
Nautilus	2016 - 2021		<u> </u>	
	2019 - 2023	DRIVER		2 nd ROW
GENERAL MOTORS (Continued on page 2)	2007 2042	DRIVER	PASSENGER	Z''" RUW
Avalanche * (See note)	2007 - 2013			
Colorado / Canyon Extended Cab – Suicide door	2015 - 2022	√ *	√ *	
Colorado / Canyon Crew Cab – 4 door	2015 - 2022	√ *	v	

LINK QUICK REFERENCE

page 2 of 3

				page 2 of 3
GENERAL MOTORS		DRIVER	PASSENGER	2 nd ROW
Sierra / Silverado Extended Cab -1500- Suicide door★	2007 - 2013	✓	✓	
Sierra / Silverado Double Cab -1500- 4 door (2 smaller)	2014 - 2018	✓	✓	
Sierra / Silverado Double Cab -1500- 4 door (2 smaller)	2019 - 2024	✓	✓	
Sierra / Silverado Crew Cab -1500- 4 door★(See note)	2007 - 2013	✓	✓	
Sierra / Silverado Crew Cab -1500- 4 door	2014 - 2018	✓	✓	
Sierra / Silverado Crew Cab -1500- 4 door	2019 - 2024	✓	✓	
Sierra / Silverado HD -2500 / 3500- Ext. & 4 door★	2007 - 2014	✓	✓	
Sierra / Silverado HD -2500 / 3500- 4 door	2015 - 2019	✓	✓	
Sierra / Silverado HD -2500 / 3500- 4 door	2020 - 2024	✓	✓	
Escalade / Suburban / Tahoe / Yukon - All models★	2007 - 2014	✓	✓	
Escalade / Suburban / Tahoe / Yukon - All models	2015 - 2020	✓	✓	
Escalade / Suburban / Tahoe / Yukon - All models	2021 - 2024	✓	✓	
Acadia	2008 - 2016		✓	
Acadia (*See note on Limited)	2017 - 2023	✓	✓	
Blazer	2019 - 2024	√*	√ *	
Cadillac XT6	2020 - 2024	✓	✓	
Enclave	2008 - 2017		✓	
Enclave	2018 - 2024	√ *	✓	√ *
Traverse	2008 - 2017		✓	
Traverse	2018 - 2023	√*	✓	√ *
Terrain / Equinox	2010 - 2017		✓	
Terrain / Equinox	2018 - 2024	✓	✓	
HONDA		DRIVER	PASSENGER	2 nd ROW
Odyssey	2018 - 2024			✓
HYUNDAI		DRIVER	PASSENGER	2 nd ROW
Palisade	2020 - 2024	√*	√*	
KIA		DRIVER	PASSENGER	2 nd ROW
Carnival	2022 - 2024	√ *	√ *	√ *
Sedona (See note)	2006 - 2014			√ *
Sedona (See note)	2015 - 2021		✓	√ *
Telluride	2020 - 2024	√*	√ *	
NISSAN		DRIVER	PASSENGER	2 nd ROW
Ariya	2022 - 2024	✓	√ *	
ТОУОТА	2022 2021	DRIVER	PASSENGER	2 nd ROW
Sienna	2011 - 2020	✓ VER	r ASSERGER ✓	∠ KOW √*
Sienna	2021 - 2024	✓	<u>·</u>	
Tacoma Access Cab – Suicide door	2005 - 2023	· · · · · · · · · · · · · · · · · · ·	· · · · · · · · · · · · · · · · · · ·	* "
Tacoma Double Cab – 4 door	2005 - 2023		· · · · · · · · · · · · · · · · · · ·	
Tundra Double Cab – 4 door (2 smaller)	2003 - 2023	√	<u> </u>	
Tundra Crew Max – 4 door	2014 - 2021	✓	<u> </u>	
Tundra Crew Max – 4 door	2022 - 2024	√ *	√ *	
Ray 4	2013 - 2018	·	<u> </u>	
Rav 4	2019 - 2024		√ *	
Venza (See note)	2008 - 2016		√ *	
Highlander	2014 - 2019		✓	
VOLKSWAGEN	2017-2013	DRIVER	PASSENGER	2 nd ROW
T	2000 2012	DRIVER ✓	PASSENGER ✓	Z ^m KUW
Routan	2009 - 2012	•	·	<u> </u>

^{*}ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. *Please schedule accordingly*.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.

LINK QUICK REFERENCE

page 3 of 3

Notes to specific ap	olications - n	narked * on the QUICK REFERENCE
Caravan / Town & Country	2008 - 2020	* STEERING COLUMN MUST BE TELESCOPIC.
Pacifica	2017 - 2024	* NOT AVAILABLE for mid-row in PINNACLE MODEL (2021+).
Ram 1500 Quad/ Crew Cab – 4 door	2019 - 2024	* NOT AVAILABLE for CLASSIC body style – 2018 model.
Jeep Wrangler – 4 door	2018 - 2023	* NOT AVAILABLE for JK model(2018)
		* NOT AVAILABLE for model with MANUAL SEAT.
Jeep Grand Cherokee	2011 - 2022	* NOT AVAILABLE for WL Platform
Journey	2008 - 2020	* ONLY AVAILABLE for model with SEAT STORAGE.
F-150 Super Cab - Suicide door / 4 door	2011 - only	* NOT AVAILABLE for model with 4 load cells (see details)
Explorer	2020 - 2024	* NOT AVAILABLE for model with MANUAL SEAT.
Raptor Super Cab - Suicide door / 4 door	2011 - only	* NOT AVAILABLE for model with 4 load cells (see details)
Ford Ranger Super Crew	2019 - 2023	* NOT AVAILABLE for model with Power Seat
Acadia	2017 - 2023	* NOT AVAILABLE for 2017 LIMITED model for the Driver
Ford Expedition (Front)	2018 - 2024	* NOT AVAILABLE for model with MANUAL SEAT.
Ford Expedition/Navigator (2 nd Row)	2018 - 2024	* ONLY AVAILABLE for Long wheelbase (Exp. MAX & Nav. L)
Navigator (Front)	2018 - 2024	* NOT AVAILABLE for model with PERFECT POSITION SEAT.
Canyon/ Colorado Ext Cab – Suicide door	2015 - 2022	* Rear door MUST BE OPEN for LINK operation.
Canyon/ Colorado Crew Cab – 4 door	2015 - 2022	* STEERING COLUMN MUST BE TELESCOPIC.
Blazer	2019 - 2024	* NOT AVAILABLE for ELECTRIC MODEL (BLAZER EV)
Enclave (Driver/Front)	2018 - 2024	* NOT AVAILABLE in driver position for model manual seat
Enclave (2 nd ROW)	2018 - 2024	* NOT AVAILABLE for 8 passenger model.
Traverse (Driver/Front)	2018 - 2023	* NOT AVAILABLE in driver position for model manual seat
Traverse	2018 - 2023	* NOT AVAILABLE for 8 passenger model.
		* NOT AVAILABLE for model with manual seat(Driver position)
Kia Carnival	2022 - 2024	* NOT AVAILABLE for 2 nd row if equipped with power seat.
Kia Sedona	2006 - 2014	* NOT AVAILABLE for short wheelbase model.
Kia Sedona	2015 - 2021	* NOT AVAILABLE for mid-row driver side with OEM footrest Discontinued in Canada 2019-2020 model.
Kia Telluride	2020 - 2024	* NOT AVAILABLE for model with MANUAL SEAT.
Hyundai Palisade	2020 - 2024	* NOT AVAILABLE for model with MANUAL SEAT.
Nissan Ariya (Front Passenger)	2022 - 2024	* NOT AVAILABLE for model with power seats.
Toyota Sienna	2011 - 2020	* NOT AVAILABLE for 8 passenger 2 nd row on the driver side
Toyota Sienna	2021 - 2024	* NOT AVAILABLE for 8 passenger 2 nd row on the driver side
Toyota Tundra	2022 - 2023	* ONLY AVAILABLE for model with POWER SEATS .
Toyota Rav 4	2019 - 2024	* ONLY AVAILABLE for model with MANUAL SEATS.
Toyota Venza	2008 - 2016	* NOT AVAILABLE for model with power seats.
ALL MODEL		If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

★NOT AVAILABLE for 2007 model with integrated seatbelt. 2007 MODEL, INCLUDES: Avalanche; Sierra / Silverado Extended Cab; Sierra / Silverado Crew Cab; Sierra / Silverado HD (2500/3500) Extended Cab / Silverado HD (2500/3500) Crew Cab; Escalade / Suburban / Tahoe / Yukon.

Tablet part #: **LK1000**Bluetooth part #: **LK1100**LINK footrest part #: **LK14000**

Need Assistance? CHAT WITH US



2008-2020

Caravan / Town & Country | DRIVER

LK-CHRG08L

Seat height: OEM

OEM shrouds must be trimmed.

Outer seat shroud removed and replaced | PROVIDED

Power seat buttons integrated into provided shroud.

⇒ Please specify if equipped with power seats.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

2008-2020

Caravan / Town & Country | FRONT PASSENGER

LK-CHRG08R Seat height: OEM

OEM shrouds must be trimmed.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

2008-2020

Caravan / Town & Country | 2nd ROW LEFT (driver side)

LK-CHRG08CL

Seat height: OEM OEM shrouds must be trimmed.

⇒ Please specify if equipped with heated seats. (Add. parts & time)

Caravan / Town & Country | 2nd ROW RIGHT (passenger side)

LK-CHRG08CR Seat height: OEM

OEM shrouds must be trimmed.

⇒ Please specify if equipped with heated seats. (Add. parts & time)

2021-2024

Grand Caravan | DRIVER

LK-CHR17L

Seat height: OEM| Adjustable seat 2.5" travel = sits 1" above lowest point) OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED Ventilated seat/fan in seat retained. (additional install time)

⇒ Please specify if equipped with power seats. (add. parts & time)

Armrest must be modified | Adapter is included

'Transfer height: 19" | Average install: 6-8 hrs. Seat| FRONT: 2 inches less than OEM| BACK: 2 inches more than OEM Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. Armrest must be modified | Retained. Action required for use.

OEM wire harness must be cut and extended under seat.

★ STEERING COLUMN MUST BE TELESCOPIC.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: OEM | BACK: OEM OEM wire harness must be cut and extended under seat.

*Transfer height: 19" | Average install: 6-8 hrs. Seat| FRONT: 5 inches more than OEM| BACK: OEM

★Must be Stow 'N Go seating (not bench)

Option available: Additional Seat Security Anchor Kit

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 5 inches more than OEM | BACK: OEM

★Must be Stow 'N Go seating (not bench)

Option available: Additional Seat Security Anchor Kit

*Transfer height: 19" | Average install: 10-14 hrs. Seat| FRONT: 2 1/4" less that OEM | BACK: 2 1/4" more than OEM Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models. If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

★Adapt Solutions' signature TALL programing NOTAVAILABLE

USER INTERACTION REQUIRED: Watch video for details. Click here for video

Grand Caravan | FRONT PASSENGER

LK-CHR17R

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point) OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED Lower Bpillar shroud needs to be cut | STENCIL PROVIDED Ventilated seat/fan in seat retained. (additional install time)

⇒ Please specify if equipped with power seats. (add. parts & time)

Transfer height: 19" | Average install: 10-14 hrs.

Seat adjustments| FRONT: 2 1/4" less that OEM| BACK: 2 1/4" more than OEM Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OBM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

Grand Caravan 2nd ROW LEFTOR RIGHT (driver or passenger side)

LK-CHR17CL or LK-CHR17CR

Seat height: OEM

OEM shrouds must be trimmed.

Doorsill moulding needs to be cut | STENCIL PROVIDED.

⇒ Please specify if equipped with heated seats. (add. parts & time)

Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: OEM | BACK: 1 ¾ " more than OEM

★Jump seat in 8 passenger model must be removed.



Pacifica | DRIVER

LK-CHR17L

Seat height: OEMI Adjustable seat 2.5" travel = sits 1" above lowest point)

OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (Additional install time)

⇒ Please specify if equipped with power seats. (Add. parts & time)

Armrest must be modified | Adapter is included

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

*Transfer height: 19" | Average install: 10-14 hrs. Seat| FRONT: 2 1/4" less that OEM | BACK: 2 1/4" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models.

Compatible with HYBRID model.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

*Transfer height: 19" | Average install: 10-14 hrs. Seat adjustments| FRONT: 21/4" less that OEM| BACK: 21/4" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees. OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

*Transfer height: 19" | Average install: 6-8 hrs.

Seat adjustments| FRONT: OEM | BACK: 1 3/4" more than OEM

★Jump seat in 8 passenger model must be removed.

★NOTAVAILABLE FOR PINNACLE MODEL (2021 & up).

USER INTERACTION REQUIRED: Watch video for details. Click he

Pacifical FRONT PASSENGER

LK-CHR17R

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point) OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (Additional install time)

⇒ Please specify if equipped with power seats. (Add. parts & time)

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

Pacifica | 2nd ROW LEFTOR RIGHT (driver or passenger side)

LK-CHR17CL or LK-CHR17CR

Seat height: OEM

OEM shrouds must be trimmed.

Doorsill moulding needs to be cut | STENCIL PROVIDED.

- ⇒ Please specify if equipped with heated seats. (Add. parts & time)
- Please specify if it is hybrid.

LK-CHR17L

Seat height: OEM| Adjustable seat 2.5" travel = sits 1" above lowest point) OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (Additional install time)

⇒ Please specify if equipped with power seats. (Add. parts & time) Armrest must be modified | Adapter is included

/oyager| DRIVER

*Transfer height: 19" | Average install: 10-14 hrs. Seat| FRONT: 2 1/4" less that OEM | BACK: 2 1/4" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor. Seathelt pre-tensioner relocated

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models. If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

★Adapt Solutions' signature TALL programing NOTAVAILABLE

USER INTERACTION REQUIRED: Watch video for details. Click here for video

2020-2024

Vovager | FRONT PASSENGER

LK-CHR17R

Seat height: OEM | Adjustable seat 2.5" travel = sits 1" above lowest point) OEM shrouds must be trimmed.

Outer seat trim modified. Inner trim replaced | PARTS PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED

Ventilated seat/fan in seat retained. (additional install time)

⇒ Please specify if equipped with power seats. (add. parts & time)

*Transfer height: 19" | Average install: 10-14 hrs. Seat adjustments| FRONT: 2 1/4" less that OEM| BACK: 2 1/4" more than OEM

Mid-row/Stow 'N Go behind LINK PERMANENTLY in or out of floor.

Seatbelt pre-tensioner relocated.

Seatbelt pre-tensioner relocated.

Compatible with HYBRID model.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

Voyager| 2nd ROW LEFTOR RIGHT (driver or passenger side 2020-2024

LK-CHR17CL or LK-CHR17CR

Seat height: OEM

OEM shrouds must be trimmed.

Doorsill moulding needs to be cut | STENCIL PROVIDED.

⇒ Please specify if equipped with heated seats. (add. parts & time)

Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: OEM | BACK: 1 34" more than OEM

★Jump seat in 8 passenger model must be removed.



Ram 1500 Crew Cab CLASSIC -4 door FRONT PASSENGER 2009-2023

LK-RAMQ09R

Seat height: OEM

OEM shrouds must be trimmed.

Seat support spring (OEM) must be cut OEM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. OEM wire harness must be cut and extended under seat.

*Transfer height: 21" | Average install: 6-8 hrs.

*Transfer height: 20" | Average install: 8-10 hrs.

★Adapt Solutions' signature TALL programing NOTAVAILABLE ★ NOTAVAILABLE for CLASSIC body style - 2018 model.

Seat adjustments| FRONT: 2"less than OEM| BACK: 1/2" more than OEM

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

Vented seat base fan removed from seat.

Ram 1500 Quad Cab CLASSIC -4 door FRONT PASSENGER

LK-RAMQ09R

Seat height: OEM OEM shrouds must be trimmed.

Seat support spring (OBM) must be cut| OBM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

LK-RAMQ19L

Seat height: 2" higher than OEM lowest (2.5"adjustable seat)

OEM shrouds must be trimmed.

Doormust be shimmed | SHIM PROVIDED

⇒ Please specify if equipped with power seats.

⇒ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL

Ram 1500 Quad Cab -4 doorl FRONT PASSENGER

LK-RAMQ19R

2019-2024

Seat height: 2" higher than OEM lowest (2.5"adjustable seat)

OEM shrouds must be trimmed.

Please specify if equipped with power seats.

*Transfer height: 20" | Average install: 8-10 hrs. Seat adjustments| FRONT: 2"less than OEM| BACK: 1/2" more than OEM OEM wire harness must be cut and extended under seat.

⇒ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL (RAMQ09R)

Ram 1500 Crew Cab -4 door| DRIVER

LK-RAMQ19L

Seat height: 2" higher than OEM lowest (2.5" adjustable seat)

OEM shrouds must be trimmed.

Doormust be shimmed | SHIM PROVIDED

⇒ Please specify if equipped with power seats.

⇒ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL

Transfer height: 20" | Average install: 8-10 hrs. Seat adjustments| FRONT: 2"less than OEM| BACK: 1/2" more than OEM OBM wire harness must be cut and extended under seat.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

★ NOTAVAILABLE for CLASSIC body style - 2018 model.

2019-2024 Ram 1500 Crew Cab -4 door FRONT PASSENGER

LK-RAMQ19R

Seat height: 2" higher than OEM lowest (2.5"adjustable seat)

OEM shrouds must be trimmed.

Please specify if equipped with power seats.

*Transfer height: 20" | Average install: 8-10 hrs. Seat adjustments| FRONT: 2"less than OEM| BACK: 1/2" more than OEM OEM wire harness must be cut and extended under seat.

◆*Transfer height: 23" | Average install: 6-8 hrs.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Vented seat base fan removed from seat

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

OEM wire harness must be cut and extended under seat.

→ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL (RAMQ09R)

2010-2018

Ram 2500/3500 -4 door| FRONTPASSENGEF

LK-RAMQ09R

Seat height: OEM

OEM shrouds must be trimmed.

Seat support spring (OEM) must be cut | OEM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

◆ Transfer height may vary with tires, wheels and suspension.

2019-2024 Ram 2500/3500 - 4 doorl FRONT PASSENGER

LK-RAMQ09R

Seat height: OEM

OEM shrouds must be trimmed.

Seat support spring (OBM) must be cut| OBM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

◆ Transfer height may vary with tires, wheels and suspension.

2018-2024 Jeep Wrangler – 4 door DRIVER

LK-WRG18L

Seat height: 3/4" higher than OEM lowest (adjustable seat)

OEM seat trim must be modified.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

Compatible with HYBRID model.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. OFM wire harness must be cut and extended under seat. Vented seat base fan removed from seat.

*Transfer height: 19" | Average install: 6-8 hrs.

Friction on center console. Wear and scratches to be expected.

MAX PRESET available. Offers 2 additional inches of vertical travel.

Seat adjustments| FRONT: 2" more than OEM| BACK: 3 1/8" less than OEM.

◆*Transfer height: 23" | Average install: 6-8 hrs.

OEM wire harness must be cut and extended under seat.

Jeep Wrangler – 4 door| FRONTPASSENGER

2018-2024 LK-WRG18R

Seat height: 3/4" higher than OEM lowest (adjustable seat)

OEM seat trim must be modified.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

★ Adapt Solutions' signature TALL programing NOTAVAILABLE

Compatible with HYBRID model.

Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2" more than OEM| BACK: 3 1/8" less than OEM.

OEM wire harness must be cut and extended under seat. Friction on center console. Wear and scratches to be expected.

MAX PRESET available. Offers 2 additional inches of vertical travel.

★ Not available for JK Model (2018)

★ Not available for JK Model (2018)

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers.

THE FIRST INSTALLATIONS will likely take a few additional hours. *Please schedule accordingly*.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL



2020-2024

Jeep Gladiatorl DRIVER

LK-WRG18L

Seat height: 3/4" higher than OEM lowest (adjustable seat)

OEM seat trim must be modified.

Lower B pillar shroud needs to be cut | STENCIL PROVIDED.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

2020-2024 Jeep Gladiatorl FRONT PASSENGER

LK-WRG18R

Seat height: 3/4" higher than OEM lowest (adjustable seat)

OEM seat trim must be modified.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

★ Adapt Solutions' signature TALL programing NOTAVAILABLE

*Transfer height: 19" | Average install: 6-8 hrs.
Seat adjustments| FRONT: 2" more than OEM| BACK: 3 1/8" less than OEM.
OEM wire harness must be cut and extended under seat.
Friction on center console. Wear and scratches to be expected.
MAX PRESET available. Offers 2 additional inches of vertical travel.

*Transfer height: 19" | Average install: 6-8 hrs.
Seat adjustments| FRONT: 2" more than OEM| BACK: 3 1/8" less than OEM.
OEM wire harness must be cut and extended under seat.
Friction on center console. Wear and scratches to be expected.
MAX PRESET available. Offers 2 additional inches of vertical travel.

2011-2022 Jeep Grand Cherokee FRONTPASSENGER

LK-GCH11R

Seat height: 1 ½ inches higher than lowest point of adjustable seat (2 ½") OEM shrouds must be trimmed.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

★ NOT A VAILABLE FOR MODEL WITH MANUAL SEATS.

2008-2020 Journey | FRONT PASSENGER

LK-JOU08R

Seat height: 1/4 inch higherthan OEM

OEM shrouds must be trimmed.

Plastic seat pan must be trimmed | OEM reconfiguration not affected

*Transfer height: 19" | Average install: 6-8hrs.
Seat adjustments| FRONT: 1 % more than OEM| BACK:1 % more than OEM
OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for WL Platform

- *Transfer height: 19" | Average install: 9-11hrs.
 Seat adjustments| FPONT: ¼ more than OEM| BACK: ¼ more than OEM
 OEM wire harmess must be cut and extended under seat.
- ★ONLY AVAILABLE FOR MODEL WITH SEAT STORAGE



2009-2014 F-150 Super Cab - Suicide door | DRIVER

LK-F150C09L

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time

2009-2014 F-150 Super Cab - Suicide door| FRONTPASSENGER

LK-F150C09R Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

F-150 Super Crew Cab - 4 door DRIVER

LK-F150C09L Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

F-150 Super Crew Cab - 4 doorl FBONT PASSENGER

LK-F150C09R Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat. Extensive wire harness work required on fully equipped models. (Add time)

Transfer height: 19" | Average install: 8-10 hrs. Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A

*Transfer height: 19" | Average install: 8-10 hrs.

Vented seats retained. OEM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

⇒ Please specify if equipped with power seats.

★NOTAVAILABLE for 2011 model with 4 load cells. (SEE INSTALL PAGE)

*Transfer height: 19" | Average install: 8-10 hrs. Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

Vented seats retained.

⇒ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat.

*Transfer height: 19" | Average install: 8-10 hrs. Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A

Vented seats retained.

OFM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2011 model with 4 load cells. (SEE INSTALL PAGE)

2011-2016 F-150 Raptor Super Cab — Suicide door| DRIVER

LK-F150C09L Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Vented seats retained.

Vented seats retained.

⇒ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

2011-2016 F-150 Raptor Super Cab - Suicide doorl FRONT PASSENGER

LK-F150C09R

Seat height: INFO N/A OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

F-150 Raptor Super Crew Cab

LK-F150C09L

Seat height: INFO N/A

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time)

F-150 Raptor Super Crew Cab - 4 d

*Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

★NOTAVAILABLE for 2011 model with 4 load cells. (SEE INSTALL PAGE)

*Transfer height: 19" | Average install: 10-12 hrs.

Vented seats retained.

⇒ Please specify if equipped with power seats.

OEM wire harness must be cut and extended under seat. oor| FRONT PASSENGER

2011-2016

LK-F150C09R

Seat height: INFO N/A OEM shrouds must be trimmed.

 $\label{thm:lnstallation} \textbf{Installation time varies depending on OEM features integrated in the $\$eat}.$

Extensive wire harness work required on fully equipped models. (Add time)

*Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Vented seats retained.

OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2011 model with 4 load cells. (SEE INSTALL PAGE)

F-150 Raptor Super Cab - Suicide door | DRIVER

LK-F150C15L

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat. Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

*Transfer height: 21" | Average install: 10-12 hrs. Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM Vented seatback retained.

⇒ Please specify if equipped with power seats.

⇒ Please specify if equipped with vented seat. (add. parts & time) OEM wire harness must be cut and extended under seat.

F-150 Raptor Super Cab Suicide door | FRONT PASSENGER

LK-F150C15R

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor. Extensive wire harness work required on fully equipped models. (Add time)

*Transfer height: 21" | Average install: 10-12 hrs. Seat adjustments | FRONT: 3 inches less than OEM | BACK: OEM

Vented seatback retained. ⇒ Please specify if equipped with power seats.

⇒ Please specify if equipped with vented seat. (add. parts & time) OBM wire harness must be cut and extended under seat.

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers.

THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.

ADAPT SOLUTIONS BACK

Transfer height: 21" | Average install: 10-12 hrs. Seat adjustments FRONT: 3 inches less than OEM | BACK: OEM

⇒ Please specify if equipped with vented seat. (add. parts & time)

*Transfer height: 21" | Average install: 10-12 hrs. Seat adjustments| FRONT: 3 inches less than OEM | BACK: OEM

⇒ Please specify if equipped with vented seat. (add. parts & time)

*Transfer height: 20" | Average install: 8-10 hrs.

⇒ Please specify if equipped with vented seat. (add. parts & time)

*Transfer height: 20" | Average install: 8-10 hrs.

⇒ Please specify if equipped with vented seat. (add. parts & time)

*Transfer height: 20" | Average install: 8-10 hrs.

⇒ Please specify if equipped with vented seat. (add. parts & time)

Transfer height: 20" | Average install: 8-10 hrs. Seat adjustments| FRONT: 3 inches less than OEM| BACK: OEM

⇒ Please specify if equipped with vented seat. (add. parts & time)

Seat adjustments| FRONT: 3 inches less than OEM| BACK: OEM

OBM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: 3 inches less than OEM| BACK: OEM

OEM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: 3 inches less than OEM| BACK: OEM

OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.



Vented seatback retained.

⇒ Please specify if equipped with power seats.

F-150 Raptor Super Crew Cab - 4 door | DRIVER

LK-F150C15L

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat. Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

F-150 Raptor Super Crew Cab - 4 door | FRONT PASSENGER

LK-F150C15R

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat. Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

2015-2024

F-150 Super Cab - Suicide door| DRIVER

LK-F150C15L

Seat height: 1/2 inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

F-150 Super Cab - Suicide door FRONT PASSENGER

2015-2024 LK-F150C15R

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

2015-2024

F-150 Super Crew Cab - 4 door | DRIVER

LK-F150C15L

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module. Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

2015-2024

F-150 Super Crew Cab - 4 doorl FRONT PASSENGER

LK-F150C15R

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

F-250, F-350, F-450 Super or Super Crew Cab — Suicide door or 4 door| DRIVER

LK-F250C11L

2011-2016

Seat height: 1/4 inch higherthan OEM (manual or power seat)

OEM shrouds must be trimmed.

OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models. (Add time)

2011-2016 LK-F250C11R

Seat height: 1/4 inch higher than OEM (manual or power seat)

OEM shrouds must be trimmed. OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models. (Add time)

- *Transfer height: 24" (F-250)| Average install: 6-8 hrs. Seat adjustments| FRONT: 2 inches less than OEM| BACK: OEM
 - ⇒ Please specify if equipped with power seats. (add. parts & time)
 - ⇒ Please specify if equipped with vented seat. (add. parts & time)

F-250, F-350, F-450 Super or Super Crew Cab - Suicide or 4 door | FRONT PASSENGER

- *Transfer height: 24" (F-250)| Average install: 6-8 hrs. Seat adjustments| FRONT: 2 inches less than OEM| BACK: OEM
- ⇒ Please specify if equipped with power seats. (add. parts & time)
- ⇒ Please specify if equipped with vented seat. (add. parts & time)

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.

^{*}ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.





F-250, F-350, F-450 Super Crew Cab - Suicide door or 4 door | DRIVER

LK-F150C15L

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time)

F-250, F-350, F-450 Super Crew Cab - Suicide or 4 door | FRONT PASSENGER

LK-F150C15R

Seat height: ½ inch lower than OEM (non-adjustable manual seat)

OEM shrouds must be trimmed.

Installation time varies depending on OEM features integrated in the seat.

Fully equipped model has large memory box module.

Additional time required for fastening memory box to the floor.

Extensive wire harness work required on fully equipped models. (Add time) 2019-2024

Ranger Super Crew Cab| FRONT PASSENGER

LK-RNG19R

Seat height: 11/16" higherthan OEM lowest (adjustable seat)

OEM seat trim must be modified.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

* NOTCURRENTLY A VAILABLE for model with power seats

Explorer | FRONT PASSENGER

LK-EXL11R

Seat height: INFO N/A

OEM shrouds must be trimmed.

Seat base must be cut | OEM reconfiguration not affected

Higher trim levels may cause loss of some seat features.

⇒ Please specify if equipped with vented seat. (add. parts & time)

2016-2019 Explorer| FRONT PASSENGER

LK-EXL16R

Seat height: 1" higher than OEM lowest (adjustable seat)

OEM shrouds must be trimmed.

Seat base must be cut | OEM reconfiguration not affected

OEM wire harness must be cut and extended under seat.

LK-EXL20L

Seat height: 5/16" higher than OEM lowest (power seat)

OEM shrouds must be trimmed.

OEM wire harness must be cut and extended under seat.

*Transfer height: 24" (4X4)| Average install: 8-10 hrs. Seat adjustments| FRONT: 3 inches less than OEM | BACK: OEM Vented seatback retained.

⇒ Please specify if equipped with power seats.

⇒ Please specify if equipped with vented seat. (add. parts & time)

OEM wire harness must be cut and extended under seat.

Transfer height: 24" (4X4) | Average install: 8-10 hrs. Seat adjustments| FRONT: 3 inches less than OEM | BACK: OEM

Vented seatback retained.

⇒ Please specify if equipped with power seats.

⇒ Please specify if equipped with vented seat. (add. parts & time)

OEM wire harness must be cut and extended under seat.

*Transfer height: 19" | Average install: 8-10 hrs. Seat adjustments| FRONT: 2" less than OEM| BACK: 1" less than OEM.

OEM wire harness must be cut and extended under seat.

* NOTCURRENTLY AVAILABLE for SuperCab model.

*Transfer height: 19" | Average install: 8-10 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

OBM wire harness must be cut and extended under seat.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

*Transfer height: 19" | Average install: 9-11 hrs. Seat adjustments| FRONT: OEM| BACK: 1 3/4" less than OEM Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

Retain fan in seat | Models with ventilated seat. ⇒ Please specify if equipped with vented seat. (add. parts & time)

*Transfer height: 19.5" | Average install: 8-10 hrs.

Explorer DRIVER 2020-2024

★Adapt Solutions' signature TALL programing NOTAVAILABLE

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. Control box relocated under the LINK.

Seat adjustments| FRONT: 3/4" less than OEM | BACK: OEM

*NOTCURRENTLY AVAILABLE for model with manual seats.

2020-2024 Explorer | FRONT PASSENGER

LK-EXL20R

Seat height: 5/16" higherthan OEM lowest (powerseat)

OEM shrouds must be trimmed.

OEM wire harness must be cut and extended under seat.

*Transfer height: 19.5" | Average install: 8-10 hrs. Seat adjustments| FRONT: 3/4" less than OEM | BACK: OEM

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. ★ NOTCURRENTLY A VAILABLE for model with manual seats.



Vented seats retained.

Expedition / Navigator FRONTPASSENGER

LK-EXP07R

Seat height: 3/8 inch higher than OEM

OEM shrouds must be trimmed.

⇒ Please specify if equipped with vented seats.

Installation time varies depending on OEM features integrated in the seat.

Extensive wire harness work required on fully equipped models. (Add time) 2018-2024

Expedition / Navigator| DRI`

LK-EXP18L

Seat height: 13/8" higher than OEM lowest (adjustable seat)

OEM seat trim must be modified.

- ⇒ Please specify if equipped with vented seat. (add. parts & time)
- ★ NOTAVAILABLE for model with MANUAL SEAT.
- ★ NOTAVAILABLE for model with PERFECT POSITION SEAT (Navigator).

*Transfer height: 21"| Average install: 8 -12 hrs.

Additional time required for fastening memory box to the floor.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 ¾ inch less than OEM| BACK:1" more than OEM

Seat adjustments| FRONT: 4 1/8" less than OEM| BACK:11/4" more than OEM

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

Fully equipped model has large memory box module.

Extensive wire harness work required on fully equipped models.

Additional time required for relocating memory box.

Plastic floor liner in 2nd row behind the LINK has to be cut or removed

2018-2024 Expedition / Navigator | FRONT

LK-EXP18R

Seat height: 13/8" higherthan OEM lowest (adjustable seat)

OEM seat trim must be modified.

- ⇒ Please specify if equipped with vented seat. (add. parts & time)
- ★NOTAVAILABLE for model with MANUAL SEAT.
- ★ NOTAVAILABLE for model with PERFECT POSITION SEAT (Navigator).

*Transfer height: 21" | Average install: 8 - 12 hrs. Seat adjustments| FRONT: 2" less than OEM| BACK:2.5" more than OEM

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

OEM wire harness must be cut and extended under seat. Extensive wire harness work required on fully equipped models.

Plastic floor liner in 2nd row behind the LINK has to be cut or removed

2018-2024

Expedition / Navigator 2nd ROW LEFT (DRIVER SIDE)

LK-EXP18CL

Seat height: OEM

Lower C pillar shroud needs to be cut | STENCIL PROVIDED.

Left & right seat trim replaced | PROVIDED

⇒ Please specify if equipped with heated seat. (add. parts & time)

★ ONLY AVAILABLE for **Long wheelbase** (Exp. MAX & Nav. L)

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2" less than OBM| BACK:2.5" more than OEM OEM wire harness must be cut and extended under seat.

Seatback PowerFold feature cancelled | Seat cannot be folded

Seat tilt & slide feature no longer functional Seatback recline no longer adjustable

Model with 2nd row center console may require LINK preset modification & decrease legroom during LINK operation

KING RANCH 7 passenger model | Inner arm rest must be removed Expedition / Navigator | 2nd ROW RIGHT (PASSENGER SIDE)

2018-2024

LK-EXP18CR

Seat height: OEM

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

Left & right seat trim replaced | PROVIDED

⊃ Please specify if equipped with heated seat. (add. parts & time)

★ ONLY AVAILABLE for **Long wheelbase** (Exp. MAX & Nav. L)

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 4 1/8" less than OEM| BACK:11/4" more than OEM

OEM wire harness must be cut and extended under seat.

Seatback PowerFold feature cancelled | Seat cannot be folded Seat tilt & slide feature no longer functional

Seatback recline no longer adjustable

Model with 2nd row center console may require LINK preset modification & decrease legroom during LINK operation

KING RANCH 7 passenger model | Inner arm rest must be removed

2013-2019

LK-ESC13R Seat height: OEM

Escapel FRONT PASSENGER

OEM shrouds must be trimmed

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: ½ inch less than OEM| BACK:1" less than OEM

OEM wire harness must be cut and extended under seat.

2015-2024

Edge | FRONT PASSENGER

LK-EDG15R

Seat height: 1/4" higher than OEM lowest (adjustable seat)

OEM shrouds must be trimmed.

⇒ Please specify if equipped with vented seat. (add. parts & time)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 1/4" more than OEM| BACK: 3/4" less than OEM OEM wire harness must be cut and extended under seat.

Extensive wire harness work required on fully equipped models.

Extensive wire harness work required on fully equipped models.

2016-2023

Lincoln MKX / Nautilus| FRONTPASSENGER

LK-EDG15R

Seat height: 1/4" higher than OEM lowest (adjustable seat)

OEM shrouds must be trimmed.

- ⇒ Please specify if equipped with vented seat. (add. parts & time)
- ⇒ Please specify if 22 position seat. (add. parts, manual & time)

*Transfer height: 19"| Average install: 10-12 hrs. Seat adjustments| FRONT: 1/4" more than OEM| BACK: 3/4" less than OEM OEM wire harness must be cut and extended under seat.

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.



Avalanche | DRIVER

LK-SILC07L

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat

2007-2013 Avalanchel FRONTPASSENGER

LK-SILC07R

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

*Transfer height: 19" | Average install: 6-8 hrs.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 3/8" less that OEM| BACK: OEM

Seat adjustments| FRONT: 2 3/8" less that OEM| BACK: OEM

OBM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

*Rear door must be open for LINK operation. ★ STEERING COLUMN MUST BE TELESCOPIC

*Transfer height: 19" | Average install: 6-8 hrs.

OBM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

2015-2022 Canyon / Colorado Extended Cab - Suicide door | DRIVER

LK-COLC15L

Seat height: OEM (adjustable seat = 3" of travel - sits at 1 $\frac{1}{2}$ inches)

OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Vented seat base fan removed from seat

Canyon / Colorado Extended Cab - Suicide door | FRONTPASSENGER 2015-2022

LK-COLC15R

Seat height: 3/4" higher than OEM OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Vented seat base fan removed from seat. 2015-2022

*Rear door must be open for LINK operation.

Canyon / Colorado Crew Cab 4 door | DRIVER

LK-COLC15L

Seat height: OEM (adjustable seat = 3" of travel - sits at 1 1/2 inches)

OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

Vented seat base fan removed from seat

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 3/8" less that OEM| BACK: OEM OEM wire harness must be cut and extended under seat.

★ STEERING COLUMN MUST BE TELESCOPIC.

2015-2022

Canvon / Colorado Crew Cab – 4 doorl FRONT PASSENGER

LK-COLC15R

Seat height: 3/4" higher than OEM

OEM shrouds must be trimmed.

Seat leans towards rear of vehicle once outside. ANGLE: 3 degrees.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments | FRONT: 2 3/8" less that OEM | BACK: OEM OBM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

2007-2013

LK-SILX07L

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Vented seat base fan removed from seat.

NOTE If seatbelt is bolted to rocker panel, see required notes below:

Seat belt reel must be relocated | BRACKET PROVIDED

Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

Replace rocker panel shroud | PROVIDED

2007-2013

LK-SILX07R

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat) OEM shrouds must be trimmed.

Vented seat base fan removed from seat.

NOTE If seatbelt is bolted to rocker panel, see required notes below:

Seat belt reel must be relocated | BRACKET PROVIDED

Sierra / Silverado Extended Cab-1500- Suicide door| FRONT PASSENGER

Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OBM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

Replace rocker panel shroud | PROVIDED

2014-2018 Sierra / Silverado Double Cab 4 door (2 smaller)| DRIVER

LK-SILC14L

Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

*Transfer height: 20" | Average install: 7-9 hrs. Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

Higher trim levels may cause loss of some seat features.

2014-2018

LK-SILC14R

Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Higher trim levels may cause loss of some seat features.

Silverado Double Cab-1500- 4 door (2 smaller) | FRONT PASSENGER *Transfer height: 20" | Average install: 7-9 hrs.

Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel)

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.

THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.

^{*}ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers.



2007-2013 Sierra / Silverado Crew Cab-1500- 4 door | DRIVER

LK-SILC07L

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat

*Transfer height: 19" | Average install: 6-8 hrs.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OBM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

Sierra / Silverado Crew Cab-1500- 4 door FRONT PASSENGER

LK-SILC07R

Seat height: ¾" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat

Transfer height: 19" | Average install: 6-8 hrs.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

Sierra / Silverado Crew Cab-1500- 4 door| DRIVER

LK-SILC14L

Seat height: OEM

OEM shrouds must be trimmed. Vented seatback retained.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

2014-2018 LK-SILC14R

Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Higher trim levels may cause loss of some seat features.

Sierra / Silverado Crew Cab & Double Cab-1500- 4 door DRIVER 2019-2024

LK-SILC19L

Seat height: 2 1/4" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed.

⇒ Please specify if 12/16-way seat (power thigh) | additional parts supplied.

⇒ Please specify if equipped with seat memory. (add. parts & time)

⇒ Please specify if equipped with vented seat. (add. parts & time)

2019-2024 LK-SILC19R

Seat height: 2 1/4" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

⇒ Please specify if 12/16-way seat (power thigh) | additional parts supplied.

⇒ Please specify if equipped with vented seat. (add. parts & time)

Transfer height: 20" | Average install: 7-9 hrs.

Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel)

OBM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat. Higher trim levels may cause loss of some seat features.

Sierra / Silverado Crew Cab-1500- 4 door FRONTPASSENGER

*Transfer height: 20" | Average install: 7-9 hrs. Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

'Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 1/4" less than OEM | BACK: 3/4" less than OEM OBM wire harness must be cut and extended under seat.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

★NOTAVAILABLE if equipped with TV/DVD in seatback

Sierra / Silverado Crew Cab & Double Cab-1500- 4 door FRONT PASSENGER

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 1/4" less than OEM | BACK: 3/4" less than OEM

OBM wire harness must be cut and extended under seat.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

Transfer height: 23" | Average install: 6-8 hrs.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

★NOTAVAILABLE if equipped with TV/DVD in seatback

Sierra / Silverado HD - 2500 / 3500-Extended Cab — Suicide door| DRIVEF

LK-SILX07L

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Vented seat base fan removed from seat.

NOTE If seatbelt is bolted to rocker panel, see required notes below:

Seat belt reel must be relocated | BRACKET PROVIDED

Serra / Silverado HD -2500 / 3500-

Replace rocker panel shroud | PROVIDED

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

LK-SILX07R

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Vented seat base fan removed from seat.

Seat belt reel must be relocated | BRACKET PROVIDED

NOTE If seatbelt is bolted to rocker panel, see required notes below:

Extended Cab - Suicide door FRONT PASSENGER

Transfer height: 23" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

Replace rocker panel shroud | PROVIDED

Sierra / Silverado HD -2500 / 3500-

LK-SILC07L

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

LK-SILC07R

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Crew Cab - 4 door | DRIVER

*Transfer height: 23" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat

Crew Cab - 4 door | FRONT PASSENGER

*Transfer height: 23" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME. If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

ADAPT SOLUTIONS **BACK**

^{*}ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers.



2015-2019

Sierra / Silverado HD -2500 / 3500- Double or Crew Cab | DRIVER

LK-SILC14L

Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

♦2500 model sits one inch higher that the 1500 & 3500 model.

Serra / Silverado HD -2500 / 3500-2015-2019

LK-SILC14R

Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Higher trim levels may cause loss of some seat features.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

2020-2024 Serra / Silverado HD -2500 / 3500- Double or Crew Cab | DRIVER

LK-SILC19L

Seat height: 2 1/4" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

- ⇒ Please specify if 12/16-way seat (power thigh) | additional parts supplied.
- ⇒ Please specify if equipped with seat memory. (Add. parts & time)
- Please specify if equipped with vented seat. (Add. parts & time)

2020-2024

◆ Transfer height may vary with tires, wheels and suspension. Sierra / Silverado HD -2500 / 3500-Double or Crew Cab | FRONT PASSENGER

LK-SILC19R

Seat height: 2 1/4" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

- ⇒ Please specify if 12/16-way seat (power thigh) | additional parts supplied.
- ⇒ Please specify if equipped with vented seat. (Add. parts & time)

PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

Escalade / Suburban / Tahoe / Yukon - All models | DRIVER

LK-SILC07L

Seat height: 3/4" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat

◆*Transfer height:19" or 23" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

◆*Transfer height: 20"-21" | Average install: 7-9 hrs. Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel)

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

◆*Transfer height: 20"-21" | Average install: 7-9 hrs. Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel)

◆*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 1/4" less than OEM | BACK: ¾" less than OEM

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

◆*Transfer height: 21" | Average install: 6-8 hrs.

Seat adjustments| FRONT: 2 1/4" less than OEM | BACK: 3/4" less than OEM

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

OEM wire harness must be cut and extended under seat.

Higher trim levels may cause loss of some seat features.

Double or Crew Cab | FRONTPASSENGER

OBM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

OBM wire harness must be cut and extended under seat.

◆ Transfer height may vary with tires, wheels & suspension.

♦2500 model sits one inch higher that the 1500 & 3500 model.

Vented seat base fan removed from seat.

Vented seat base fan removed from seat.

OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat

♦HD models sit 4 inches higher. Estimated transfer height 23 inches from the ground. All models FRONT PASSENGER

Escalade / Suburban /

LK-SILC07R

Seat height: 34" higher than OEM (at lowest point on adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Vented seat base fan removed from seat Escalade / Suburban /

◆*Transfer height:19" or 23" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

★NOTAVAILABLE for 2007 model with seatbelt integrated into the seat ♦HD models sit 4 inches higher. Estimated transfer height 23 inches from the ground.

2015-2020

LK-SILC14L Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Lower Bpillar shroud needs to be cut! STENCIL PROVIDED.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

*Transfer height: 20" | Average install: 7-9 hrs. Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel)

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

Higher trim levels may cause loss of some seat features.

2015-2020 Escalade / Suburban / Tahoe / Yukon - All models FRONT PASSENGER

LK-SILC14R

Seat height: OEM

OEM shrouds must be trimmed.

Vented seatback retained.

Higher trim levels may cause loss of some seat features.

*Transfer height: 20" | Average install: 7-9 hrs. Seat adjustments| FRONT: INFO N/A| BACK: OEM (7 inches of travel) OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat.

If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.



Escalade / Suburban / Tahoe / Yukon - All models| DRIVER

LK-SILC 19L

Seat height: 21/4" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

⇒ Please specify if 12/16-way seat (power thigh) | additional parts supplied. Extensive wire harness work required on fully equipped models. (Add time)

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 1/4" less than OEM | BACK: 3/4" less than OEM OBM wire harness must be cut and extended under seat.

⇒ Please specify if equipped with seat memory. (add. parts & time)

⇒ Please specify if equipped with vented seat. (add. parts & time) If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

2021- 2024

Escalade / Suburban / Tahoe / Yukon - All models| FRONT PASSENGEF

LK-SILC19R

Seat height: 2 1/4" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

⇒ Please specify if 12/16-way seat (power thigh) | additional parts supplied. Extensive wire harness work required on fully equipped models. (Add time) 2008-2016

Acadial FRONT PASSENGER

LK-TRV08R

Seat height: INFO N/A

OEM shrouds must be trimmed.

Vehicle battery access available | Installation does not block access.

GMC Acadia Limited 2017 (Built on 2016 body style)

Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 1/4" less than OEM | BACK: 3/4" less than OEM OBM wire harness must be cut and extended under seat.

⇒ Please specify if equipped with vented seat. (add. parts & time) If equipped with TV/DVD in seatback, UNITNO LONGER FUNCTIONAL PLEASE NOTE: Sunroof diminishes headroom (Approx. 2 inches)

Seat support spring (OEM) must be cut | OEM reconfiguration not affected

Acadia / 2020-2022

LK-ACA17L

Seat height: 2 1/2" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

Lower B pillar shroud must be cut | STENCIL PROVIDED

- ⇒ Please specify if POWER SEAT.
- ★ Adapt Solutions' signature TALL programing NOTAVAILABLE Doormust be shimmed | SHIM PROVIDED
- **★NOTAVAILABLE for 2017 ACADIA LIMITED MODEL**

Cadillac XT6 | DRIVER *Transfer height: 19" | Average install: 6-8 hrs.

*Transfer height: 19" | Average install: 6-8 hrs.

Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: 3/4" less than OEM| BACK: 1" less than OEM Vented seat base fan removed from seat.

OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

Seat offset 1" to the left of the steering.

If equipped with manual seats, recline handle is replaced | PROVIDED

Cadillac XT6| FRONT PASSENGER

LK-ACA17R

Seat height: 2 1/2" higher than OEM lowest (3" adjustable seat)

2017 GMC Acadia Limited model use 2016 Acadia KIT

- ★Adapt Solutions' signature TALL programing NOTAVAILABLE
- ⇒ Please specify if POWER SEAT.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: ¾" less than OEM| BACK: 1" less than OEM

OEM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

2019-2024

Blazerl DRIVER

LK-BLZ19L

Seat height: 2 1/2" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed. Lower Bpillar shroud must be cut | STENCIL PROVIDED

⇒ Please specify if POWER SEAT.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

Doormust be shimmed | SHIM PROVIDED

★ NOTAVAILABLE for ELECTRIC MODEL (BLAZER EV)

*Transfer height: 19" | Average install: 6-8 hrs.

Seat adjustments| FRONT: 3/4" less than OEM| BACK: 1" less than OEM ⇒ Please specify if equipped with vented seat. (Add. parts & time)

OEM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

Seat offset 1" to the left of the steering. If equipped with manual seats, recline handle is replaced | PROVIDED

Blazer | FRONT PASSENGER

LK-BLZ19R

Seat height: 2 1/2" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

- ⇒ Please specify if POWER SEAT.
- ★Adapt Solutions' signature TALL programing NOTAVAILABLE
- ★ NOTAVAILABLE for ELECTRIC MODEL (BLAZER EV)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: ¾" less than OEM| BACK: 1" less than OEM

⇒ Please specify if equipped with vented seat. (Add. parts & time) OFM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.



2008-2017 Enclave | FRONT PASSENGER *Transfer height: 19" | Average install: 6-8 hrs. LK-TRV08R Seat height: INFO N/A Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A OEM shrouds must be trimmed. OEM wire harness must be cut and extended under seat. Vehicle battery access available | Installation does not block access. Seat support spring (OEM) must be cut| OEM reconfiguration not affected 2008-2017 Traversel FRONT PASSENGER LK-TRV08R *Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A | BACK: INFO N/A Seat height: INFO N/A OEM shrouds must be trimmed. OEM wire harness must be cut and extended under seat Vehicle battery access available | Installation does not block access. Seat support spring (OEM) must be cut OEM reconfiguration not affected 2018-2024 Enclave | DRIVER LK-TRV18L *Transfer height: 19" | Average install: 10-14 hrs. Seat adjustments| FRONT: 11/4" less than OEM| BACK: 1/2" more than OEM Seat height: 3" higher than OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. OEM wire harness must be cut and extended under seat. Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. Adapt Solutions' signature TALL programing NOTAVAILABLE ⇒ Please specify if equipped with vented seat. (add. parts & time) ★ ONLY AVAILABLE for model with POWER SEATS. Traverse | DRIVER *Transfer height: 19" | Average install: 10-14 hrs. Seat adjustments| FRONT: 11/4" less than OEM| BACK: 1/2" more than OEM LK-TRV18L Seat height: 3" higherthan OEM lowest (3" adjustable seat) OEM shrouds must be trimmed. OBM wire harness must be cut and extended under seat. Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. Adapt Solutions' signature TALL programing NOTAVAILABLE ⇒ Please specify if equipped with vented seat. (add. parts & time) ★ ONLY AVAILABLE for model with POWER SEATS. Enclave FRONT PASSENGER LK-TRV18R *Transfer height: 19" | Average install: 10-14 hrs. Seat height: 3" higher than OEM lowest (3" adjustable seat) Seat adjustments| FRONT: 11/4" less than OEMI BACK: 1/2" more than OEMI OEM shrouds must be trimmed. OEM wire harness must be cut and extended under seat. ⇒ Please specify if equipped with vented seat. (add. parts & time) Adapt Solutions' signature TALL programing NOTAVAILABLE 2018-2023 Traverse FRONT PASSENGER LK-TRV18R *Transfer height: 19" | Average install: 10-14 hrs. Seat height: 3" higher than OEM lowest (3" adjustable seat) Seat adjustments| FRONT: 11/4" less than OEMI BACK: 1/2" more than OEMI OEM shrouds must be trimmed. OBM wire harness must be cut and extended under seat. ⇒ Please specify if equipped with vented seat. (add. parts & time) Adapt Solutions' signature TALL programing NOTAVAILABLE Enclave | 2nd ROW LEFT (driver side) LK-TRV18CL *Transfer height: 19" | Average install: 4-6 hrs. Seat height: OEM Seat adjustments| FRONT: 2 1/2" more than OEM | BACK: 1" more than OEM ★NOTAVAILABLE for 8 passenger model. Seatback recline no longer adjustable| Remains completely upright. Please specify if equipped with heated seat. (add. parts & time) Seatback flat folding feature cancelled | Cannot be folded. 2018-2023 Traverse | 2nd BOW LEET (driver side) LK-TRV18CL *Transfer height: 19" | Average install: 4-6 hrs. Seat height: OEM Seat adjustments| FRONT: 2 1/2" more than OEM | BACK: 1" more than OEM ★NOTAVAILABLE for 8 passenger model. Seatback recline no longer adjustable | Remains completely upright. ⇒ Please specify if equipped with heated seat. (add. parts & time) Seatback flat folding feature cancelled | Cannot be folded. Enclave | 2nd ROW RIGHT (passenger side) 2018-2024 LK-TRV18CR *Transfer height: 19" | Average install: 4-6 hrs. Seat adjustments| FRONT: 21/2" more than OEM | BACK: 1" more than OEM Seat height: OFM Seatback recline no longer adjustable | Remains completely upright. 'Smart Slide®' quick access to 3rd row feature no longer functional. Seatback flat folding feature cancelled | Cannot be folded. ★NOTAVAILABLE for 8 passenger model. ⇒ Please specify if equipped with heated seat. (add. parts & time) 2018-2023 Traversel 2nd ROW RIGHT(passenger side) LK-TRV18CR 'Transfer height: 19" | Average install: 4-6 hrs. Seat adjustments| FRONT: 2 1/2" more than OEM | BACK: 1" more than OEM Seat height: OEM

'Smart Slide®' quick access to 3rd row feature no longer functional.

★NOTAVAILABLE for 8 passenger model.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.

Seatback recline no longer adjustable | Remains completely upright.

⇒ Please specify if equipped with heated seat. (add. parts & time)

Seatback flat folding feature cancelled | Cannot be folded.

^{*}ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.

2010-2017 Terrain / Equinox | FRONT PASSENGER

LK-TER10R

Seat height: OEM

OEM shrouds must be trimmed.

Outer seat shroud removed and replaced | PROVIDED.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

2018-2024 Terrain / Equinox| DRIVER

LK-TER18L

Seat height: 2 1/4" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

Lower Bpillar shroud must be cut.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: OEM | BACK: 1/2" less than OEM OEM wire harness must be cut and extended under seat Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

Transfer height: 19" | Average install: 5-7 hrs. Seat adjustments| FRONT: OEM | BACK: 1" less than OEM

OEM wire harness must be cut and extended under seat.

Seat recline handle removed and replaced | PROVIDED.

2018-2024 Terrain / Equinox | FRONT PASSENGER

LK-TER18R

Seat height: 2" higher than OEM lowest (3" adjustable seat)

OEM shrouds must be trimmed.

★ Adapt Solutions' signature TALL programing NOTAVAILABLE

⇒ Please specify if POWER SEAT.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: ½" more than OEM | BACK: 1" less than OEM OEM wire harness must be cut and extended under seat.

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

⇒ Please specify if equipped with vented seat. (add. parts & time)

Transfer height: 19" | Average install: 4-6 hrs. Seat adjustments| FRONT: 2 1/4 more than OEM | BACK: 3/4 more than OEM



2018-2024 Odyssey| 2nd ROW LEFT (driver side)

LK-HDA18CL

Seat height: 1 inch higher than OEM

Jump seat in 8 passenger model is retained.

Option available: Additional Seat Security Anchor Kit

CAUTION: Window of mid-row door must always be closed for LINK Operation. If open, door will not fully open. DANGER OF VEHICLE DAMAGE

2018-2024 Odvssevl 2nd ROW RIGHT (passenger side)

LK-HDA18CR

Seat height: 1 inch higher than OEM

Jump seat in 8 passenger model is retained.

*Transfer height: 19"

Seat adjustments| FRONT: 2 1/4 more than OEM | BACK: 3/4 more than OEM

⇒ Please specify if 7 or 8 passengers.

⇒ Please specify if 7 or 8 passengers.

Option available: Additional Seat Security Anchor Kit

CAUTION: Window of mid-row door must always be closed for LINK Operation. If open, door will not fully open. DANGER OF VEHICLE DAMAGE



2020-2024 Palisade | DRIVER

LK-PAL20L

Seat height: 1 3/4" lower than OEM highest | 3/8" higher than OEM lowest

OEM shrouds must be trimmed | STENCIL PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. Doormust be shimmed | SHIM PROVIDED

If your seat is equipped with extendable thigh support, feature is cancelled

Palisade | FRONT PASSENGER

2020-2024 LK-PAL20R

Seat height: 2 1/8" lower than OEM highest 3/8" higher than OEM lowest

OEM shrouds must be trimmed | STENCIL PROVIDED

Doormust be shimmed | SHIM PROVIDED

If your seat is equipped with ventilation, feature is cancelled

*Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: 1 3/4" less than OEM| BACK: 1 3/4" more than OEM OEM wire harness must be cut and extended under seat. If your seat is equipped with ventilation, feature is cancelled Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

★ NOTA VAILABLE FOR MODELS WITH MANUAL SEAT

*Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: 1 3/4" less than OEM| BACK: 1 3/4" more than OEM OBM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

★ NOTA VAILABLE FOR MODELS WITH MANUAL SEAT



2022-2024 Ariya DRIVER

LK-ARY22L

Seat height: 2 1/8" lower than OEM highest 7/8" higher than OEM lowest

OEM shrouds must be trimmed | STENCIL PROVIDED

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

Doormust be shimmed | SHIM PROVIDED

*Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments FRONT: 2" less than OEM BACK: 3 1/4" more than OEM OBM wire harness must be cut and extended under seat. Seat leans towards rear of vehicle once outside. ANGLE: 4.5 degrees Fabric flap behind the seat has to be cut & modified

*Adapt Solutions' signature TALL programing NOTAVAILABLE

2022-2024 Ariva | FRONTPASSENGER

LK-ARY22R

Seat height: 2 1/8" lower than OEM highest 7/8" higher than OEM lowest OEM shrouds must be trimmed | STENCIL PROVIDED Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

Doormust be shimmed | SHIM PROVIDED

*Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: 2 3/4" less than OEM| BACK: 4" more than OEM OEM wire harness must be cut and extended under seat. Fabric flap behind the seat has to be cut & modified **★**NOTAVAILABLE FOR MODELS WITH POWER SEAT

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers.

THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.



2006-2014 Sedona | 2nd ROW LEFT (driver side) ◆◆not available for SHORT WHEELBASE *Transfer height: 19" | Average install: 4-6 hrs. Seat adjustments| FRONT: 1 ½ more than OEM| BACK: 1" more than OEM LK-KIA06CL Seat height: 1/2 inch higher than OEM OEM shrouds must be trimmed. ★MUSTBE A LONG WHEELBASE - NOTAVAILABLE FOR SHORT WHEELBASE. IT(passengerside) **♦♦***not available for SHORTWHEELBAS*E LK-KIA06CR *Transfer height: 19" | Average install: 4-6 hrs. Seat height: ½ inch higher than OEM Seat adjustments| FRONT: 1 ½ more than OEM| BACK: 1" more than OEM ★ MUST BE A LONG WHEELBASE - NOTAVAILABLE FOR SHORT WHEELBASE OEM shrouds must be trimmed. 2015-2021 Sedonal FRONT PASSENGER *Transfer height: 19" | Average install: 6-8 hrs. LK-KIA16R Seat height: OEM (adjustable seat = 3" of travel - sits 1" higher than lowest) Seat adjustments| FRONT: 34" less than OEM | BACK: 114" more than OEM OEM shrouds must be trimmed. OBM wire harness must be cut and extended under seat. Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. Higher trim levels may cause loss of some seat features. ⇒ Please specify if POWER SEATS| additional parts supplied. Vented seat base fan removed from seat Sedonal 2nd ROW LEFT (driver side) 2015-2021 LK-KIA16CL *Transfer height: 19" | Average install: 7-9 hrs. Seat adjustments| FRONT: 11/2" more than OEM | BACK: OEM Seat height: OEM OEM shrouds must be trimmed. ⇒ Please specify if equipped with heated seats. (Add. parts & time) ★ NOTAVAILABLE FOR MODELS WITH OEM FOOTREST| Discontinued in Canada 2019-2020 model. Sedonal 2nd ROW RIGHT (passenger side) LK-KIA16CR Transfer height: 19" | Average install: 7-9 hrs. Seat height: OEM Seat adjustments| FRONT: 11/2" more than OEM | BACK: OEM ⇒ Please specify if equipped with heated seats. (Add. parts & time) OEM shrouds must be trimmed. ⇒ Please specify if equipped with OEM footrest | LK-KIA16CFR (Footrest removed) 2022-2024 LK-KIA22L *Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: 1/4'' less than OEM| BACK: 3/4'' more than OEM Seat height: 1 34" lower than OEM highest | 1 1/4" higher than OEM lowest Bpillar shroud needs to be cut | STENCIL PROVIDED OBM wire harness must be cut and extended under seat. OEM seat trim must be modified | STENCIL PROVIDED Floor mat behind the LINK has to be removed or modified ★NOTAVAILABLE FOR MODELS WITH MANUAL SEAT Fabric flap behind the seat has to be cut & modified ★Adapt Solutions' signature TALL programing NOTAVAILABLE Vented seat base fan removed from seat. Carnivall FRONT PASSENGER *Transfer height: 19" | Average install: 10-12 hrs. Seat adjustments| FRONT: 1^{7/8''} less than OEM| BACK: 1^{3/8''} more than OEM Seat height: 11/8''higherthan OEM highest | 11/8'' higherthan OEM lowest OBM wire harness must be cut and extended under seat. OEM seat trim must be modified | STENCIL PROVIDED Control box needs to be relocated. Occupant sensor plug must be extended directly from the floor Custom tool provided for access to spare wheel under LINK. Floor mat behind the LINK has to be removed or modified ⇒ Please specify if POWER SEATS different install manual supplied. Fabric flap behind the seat has to be cut & modified Vented seat base fan removed from seat. 2022-2024 Carnival | 2nd ROW LEFT (driver side) LK-KIA22CL *Transfer height: 18 1/4" | Average install: 6-8 hrs. Seat adjustments FRONT: 17/8" less than OEM | BACK: 1" less than OEM Seat height: 9/16''higher than OEM highest| 9/16'' higher than OEM lowest OEM seat trim must be modified | STENCIL PROVIDED ★ NOTA VAILABLE IF EQUIPPED WITH POWER SEAT Rearfoam of the seat cushion must be modified 2022-2024 Carnival | 2nd ROW RIGHT (passenger side Transfer height: 18 1/4" | Average install: 6-8 hrs. LK-KIA22CR Seat height: 9/16" higher than OEM highest | 9/16" higher than OEM lowest Seat adjustments FRONT: 17/8" less than OEM | BACK: 1" less than OEM ★ NOTA VAILABLE IF EQUIPPED WITH POWER SEAT OEM seat trim must be modified | STENCIL PROVIDED Rearfoam of the seat cushion must be modified 2020-2024 Telluride | DRIVER LK-PAL20L *Transfer height: 19" | Average install: 10-12 hrs. Seat height: 1 34'' lower than OEM highest | 3/8 '' higher than OEM lowest Seat adjustments | FRONT: 1 3/4" less than OEM | BACK: 1 3/4" more than OEM OEM shrouds must be trimmed | STENCIL PROVIDED OBM wire harness must be cut and extended under seat. Lower Bpillar shroud needs to be cut | STENCIL PROVIDED. If your seat is equipped with ventilation, feature is cancelled Door must be shimmed | SHIM PROVIDED Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees If your seat is equipped with extendable thigh support, feature is cancelled ★NOTAVAILABLE FOR MODELS WITH MANUAL SEAT Telluride | FRONT PASSENGER LK-PAL20R *Transfer height: 19" | Average install: 10-12 hrs. Seat height: 2 1/8 ''lower than OEM highest| 3/8 '' higher than OEM lowest Seat adjustments| FRONT: 1 3/4" less than OEM| BACK: 1 3/4" more than OEM OEM shrouds must be trimmed | STENCIL PROVIDED OEM wire harness must be cut and extended under seat. Door must be shimmed | SHIM PROVIDED Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees

★NOTAVAILABLE FOR MODELS WITH MANUAL SEAT

If your seat is equipped with ventilation, feature is cancelled

^{*}ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. *Please schedule accordingly.*



Siennal DRIVER

LK-TOY11L

Seat height: OEM (Manual seat) | 1" lower than OEM top (adjustable seat)

OEM shrouds must be trimmed.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

- ⇒ Please specify if POWER SEATS| additional parts supplied.
- ⇒ Please specify if ALL WHEEL DRIVE additional parts supplied.

Sienna| FRONT PASSENGER

LK-TOY11R

Seat height: OEM (Manual seat) | 1" lower than OEM top (adjustable seat) OEM shrouds must be trimmed.

- ⇒ Please specify if POWER SEATS| additional parts supplied.
- ⇒ Please specify if JBL SOUND SYSTEM| additional parts supplied.

Siennal 2nd ROW LEFT (driver side

LK-TOY11CL

Seat height: OEM OEM shrouds must be replaced | PROVIDED.

PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY)

⇒ Please specify if equipped with OEM footrest/ LK-TOY11CFL Footrest removed

Siennal 2nd ROW RIGHT(passenger side)

LK-TOY11CR

Seat height: OEM

OEM shrouds must be replaced | PROVIDED.

⇒ Please specify if equipped with OEM footrest/ LK-TOY11CFR Footrest removed

2021-2024

Siennal DRIVER

LK-TOY21L

Seat height: OEM

OEM shrouds must be trimmed.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

⇒ Please specify if POWER SEATS| additional parts supplied.

(Black trims will be supplied for all interiors)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 3.5" less than OEM| BACK: OEM

OEM wire harness must be cut and extended under seat. Armrest must be modified | Retained. Action required for use.

⇒ Please specify if ADJUSTABLE ARMREST WITH BUTTON.

PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 3.5" less than OEM| BACK: OEM

OBM wire harness must be cut and extended under seat. ⇒ Please specify if ALL WHEEL DRIVE additional parts supplied.

PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY)

*Transfer height: 19" | Average install: 7-9 hrs. Seat adjustments| FRONT: 5 1/4" less than OEM| BACK: OEM (9" travel) Gas tank must be partially lowered to access floor adaptor bolts.

★NOTAVAILABLE FOR 8 PASSENGER SIENNA (60/40 SPLIT)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments | FRONT: 5 1/4" less than OEM | BACK: OEM (9" travel)

PLEASE SEE ADDITIONAL SPECIFICATION SHEET. (BATTERY)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 3" less than OEM| BACK: 2 1/2" more than OEM OEM wire harness must be cut and extended under seat.

★Fan removed from seat and seatback.

★Fan removed from seat and seatback.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

*Transfer height: 19" | Average install: 6-8 hrs.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

⇒ Please specify if SEAT is equipped with LUMBAR SUPPORT.

Seat adjustments| FRONT: 3.5" less than OEM| BACK: OEM

OEM wire harness must be cut and extended under seat.

Siennal FRONTPASSENGEF

LK-TOY21R

Seat height: OEM

OEM shrouds must be trimmed.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

⇒ Please specify if POWER SEATS| additional parts supplied.

(Black trims will be supplied for all interiors)

2021-2024

Siennal 2nd ROW LEFT (driver side)

LK-TOY21C7L

Seat height: 5/16" higher than OEM

OEM wire harness must be cut and extended under seat.

(Black trims will be supplied for all interiors)

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT:7/8" more than OEMI BACK: 3 1/4" less than OEM.

★ NOT CURRENTLY AVAILABLE FOR MODEL WITH OEM FOOTREST.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT:7/8" more than OEM| BACK: 3 1/4" less than OEM.

★NOTAVAILABLE FOR 8 PASSENGERS

2021-2024

Siennal 2nd ROW RIGHT(passenger side)

LK-TOY21C7R

Seat height: 5/16" higher than OEM

OBM wire harness must be cut and extended under seat.

* NOTCURRENTLY A VAILABLE FOR MODEL WITH OEM FOOTREST.

(Black trims will be supplied for all interiors)

⇒ Please specify if 8 passengers/ LK-TOY21C8R.

2005-2023 Tacoma Access Cab — Suicide door| FRONT PASSENGER

LK-TACD05R Seat height: 1" higherthan OEM

OEM shrouds must be trimmed.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

2005-2023

Tacoma Double Cab - 4 doorl FRONT PASSENGER

LK-TACD05R

Seat height: 1" higherthan OEM

OEM shrouds must be trimmed.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

*Transfer height: 19" | Average install: 4-6 hrs.

Seat adjustments| FRONT: 1/2" less than OEM| BACK: 1" less than OEM OBM wire harness must be cut and extended under seat.

*Transfer height: 19" | Average install: 4-6 hrs. Seat adjustments| FRONT: 1/2" less than OEM| BACK: 1" less than OEM OBM wire harness must be cut and extended under seat.

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers.

THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.

If equipped with TV/DVD in seatback, UNIT NO LONGER FUNCTIONAL

HIGHER TRIM LEVELS REQUIRE ADDITIONAL INSTALLATION TIME.

ADAPT SOLUTIONS **BACK**



2014-2021 Tundra Double Cab - 4 door (2 smaller) | DRIVER

LK-TUN14L

Seat height: OEM (Manual seat)| 1" higher than OEM lowest (adjustable seat)

OEM shrouds must be trimmed.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

⇒ Please specify if 12 way seat (power thigh) | additional parts supplied.

Higher trim levels may cause loss of some seat features. ler) | FRONT PASSENGER

2014-2021 Tundra Double Cab - 4 door (2 sma *Transfer height: 21" | Average install: 6-8 hrs.

LK-TUN14R Seat height: OEM (Manual seat)| 1" higher than OEM lowest(adjustable seat) OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

2014-2021 Tundra Crew Max - 4 door | DRIVER

LK-TUN14L Seat height: OEM (Manual seat)| 1" higher than OEM lowest(adjustable seat)

OEM shrouds must be trimmed. Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

⇒ Please specify if 12 way seat (power thigh) | additional parts supplied.

Higher trim levels may cause loss of some seat features.

2014-2021 Tundra Crew Max – 4 door|

LK-TUN14R Seat height: OEM (Manual seat)| 1" higher than OEM lowest(adjustable seat)

OEM shrouds must be trimmed.

Higher trim levels may cause loss of some seat features.

Tundra Crew Max

LK-TUN22L Seat height: 2" higher than OEM lowest (adjustable seat)

OEM shrouds must be trimmed.

Door must be $shimmed \mid SHIM PROVIDED$

Control box needs to be relocated.

Lower B pillar shroud needs to be $\operatorname{cut}|\operatorname{STENCIL}\operatorname{PROVIDED}.$

⇒ Please specify if equipped with OEM footrest

*Transfer height: 21 1/2" | Average install: 8-10 hrs.

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 1" less than OEM| BACK: OEM

OEM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: 1" less than OEM| BACK: OEM

OBM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: 1" less than OEM| BACK: OEM

OBM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat. (In LIMITED & 1794)

*Transfer height: 21" | Average install: 6-8 hrs.

*Transfer height: 21" | Average install: 6-8 hrs. Seat adjustments| FRONT: 1" less than OEM| BACK: OEM

Vented seat base fan retained.

Vented seat base fan retained.

Seat adjustments| FRONT: 1/2" less than OEM| BACK: OEM OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

OEM wire harness must be cut and extended under seat.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 3 1/4" less than OEM| BACK: 2 1/4" more than OEM

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: ½" less than OEM| BACK: OEM

Fabric flap behind the seat has to be cut & modified

OBM wire harness must be cut and extended under seat.

Vented seat base fan removed from seat. (In LIMITED & 1794)

Fabric flap behind the seat has to be cut & modified Ventilated seat removed

Ventilated seat removed

★ONLY A VAILABLE FOR POWER SEATS

★ONLY AVAILABLE FOR POWER SEATS.

Vented seat base fan removed from seat.

★ONLY AVAILABLE FOR MANUAL SEATS.

Tundra Crew Max - 4 door| FRONT PASSENGER 2022-2024

*Transfer height: 21 1/2" | Average install: 8-10 hrs. LK-TUN22R Seat adjustments| FRONT: 1/2" less than OEM| BACK: OEM

Seat height: 2" higherthan OEM lowest(adjustable seat)

OEM shrouds must be trimmed.

Door must be shimmed | SHIM PROVIDED Control box needs to be relocated.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED

2013-2018 Rav 41 FRONT PASSENGER LK-RAV13R

Seat height: 1/2" higher than OEM

OEM shrouds must be trimmed.

⇒ Please specify if POWER SEATS| additional parts supplied.

Rav 41 FRONT PASSENGE LK-RAV19R

Seat height: 1/2" higher than OEM

OEM shrouds must be trimmed.

Door must be shimmed | SHIM PROVIDED

*Adapt Solutions' signature TALL programing NOTAVAILABLE

Compatible with HYBRID model.

2008-2016 enzal FRONT PASSENGER**

LK-VNZ08R

Seat height: INFO N/A

OEM shrouds must be trimmed.

Door opening increased with shim | PROVIDED.

★Adapt Solutions' signature TALL programing NOTAVAILABLE

Highlander FRONT PASSENGER

LK-HLD14R

Seat height: OEM

OEM shrouds must be trimmed.

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

⇒ Please specify if POWER SEATS| additional parts supplied.

Compatible with HYBRID model.

*Transfer height: 19" | Average install: 5-7 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Seat leans towards rear of vehicle once outside. ANGLE: 5 degrees.

OEM wire harness must be cut and extended under seat. ★NOTAVAILABLE IF EQUIPPED WITH POWER SEATON PASSENGER SIDE.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 2 1/4" less than OEM.| BACK: 11/4" more than OEM OEM wire harness must be cut and extended under seat. Vented seat base fan removed from seat.

Vented seatback retained.

*ESTIMATED height and installation time in base model. Install times as reference only and apply to seasoned installers. THE FIRST INSTALLATIONS will likely take a few additional hours. Please schedule accordingly.



Volkswagen

0000 0040	D	DRIVER
2009-2012	Halitani	
 		

LK-CHRG08L

Seat height: OEM

OEM shrouds must be trimmed.

Outer seat shroud removed and replaced | PROVIDED Power seat buttons integrated into provided shroud.

⇒ Please specify if equipped with power seats.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

Lower Bpillar shroud needs to be cut | STENCIL PROVIDED.

Armrest must be removed | COVER CAP PROVIDED. OBM wire harness must be cut and extended under seat.

Seat adjustments| FRONT: INFO N/A| BACK: INFO N/A

OEM wire harness must be cut and extended under seat.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be

*Transfer height: 19" | Average install: 6-8 hrs.

stowed.

2009-2012

Routan | FRONT PASSENGER

LK-CHRG08R

Seat height: OEM

OEM shrouds must be trimmed.

Mid-row seat (Stow 'N Go) immediately behind LINK cannot be stowed.

2009-2012

LK-CHRG08CL Seat height: OEM

OEM shrouds must be trimmed.

Routan | 2nd ROW LEFT (driver side)

*Transfer height: 19" | Average install: 6-8 hrs. Seat| FRONT: 5 inches more than OEM| BACK: OEM

★Must be Stow 'N Go seating (not bench)

2009-2012

LK-CHRG08CR Seat height: OEM

OEM shrouds must be trimmed.

*Transfer height: 19" | Average install: 6-8 hrs. Seat adjustments| FRONT: 5 inches more than OEM | BACK: OEM

★ Must be Stow 'N Go seating (not bench)

XL-BASE





FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all of the key features of the product.



PRODUCT VIDEO

Overview of the XL-BASE in motion.



HIGHLIGHTS:

- ALWAYS OEM seat. 350 lbs capacity.
- Optional armrest and footrest available.
- Seatback adjustment remains intact.
- Seating behind XL-BASE not affected
- Simple mechanical mechanism.



THINGS TO NOTE

Only available on passenger side of some minivans. See application list. Forward and back adjustment lost. Seat sits at OEM furthest back position.



XL-BASE QUICK REFERENCE

The XL-BASE is only available for passenger side.

CHRYSLER		PASSENGER
Caravan / Town & Country / Voyager - Short & Long wheelbase	1991 - 2004	Fro nt
Caravan / Town & Country - Without Stow 'N Go	2005 - 2007	Fro nt
Caravan / Town & Country - Stow 'N Go	2005 - 2007	Front
Caravan / Town & Country	2008 - 2020	Front
Caravan / Town & Country - Short wheelbase	2001 - 2007	Center
Caravan / Town & Country - Long wheelbase	2001 - 2007	Center
Caravan / Town & Country - Stow 'N Go	2005 - 2020	Center
Town & Country - Swivel 'N Go - NOTAVAILABLE	2008 - 2011	Center
FORD		PASSENGER
Windstar - Without power seat	1995 - 2003	Front
Freestar / Monterey - Without power seat	2004 - 2007	Front
Freestar / Monterey - Power seat	2004 - 2007	Front
Windstar	1995 - 2003	Center
Freestar / Monterey	2004 - 2007	Center
GENERAL MOTORS	2001 2007	PASSENGER
♦Astro / Safari	1995 - 2005	Front
◆Montana / Sihouette / Transport / Venture	1997 - 2004	Front
◆Montana / SV6 / Terraza / Uplander / Venture / Relay	2005 - 2009	Front
Astro / Safari - NOTAVAILABLE	1997 - 2005	Center
◆Montana / Sihouette / Transport / Venture	1997 - 2004	Center
Montana / Sv6 / Terraza / Uplander / Venture / Relay	2005 - 2009	Center
	2005 - 2009	PASSENGER
HONDA	0005 0010	
Odyssey - NOTAVAILABLE	2005 - 2010	Front
Odyssey - DISCONTINUED 2024-02-05	2011 - 2017	Front
Odyssey - NOTAVAILABLE	2018 - 2024	Front
Odyssey	2005 - 2010	Center
Odyssey	2011 - 2017	Center
Odyssey - NOTAVAILABLE	2018 - 2024	Center
HYUNDAI		PASSENGER
Entourage - NOTAVAILABLE	2006 - 2009	Front
Entourage	2006 - 2009	Center
KIA		PASSENGER
Sedona	1999 - 2005	Front
Sedona - NOTAVAILABLE	2006 - 2012	Front
Sedona - NOTAVAILABLE	2014 - 2021	Front
Sedona	1999 - 2005	Center
Sedona	2006 - 2012	Center
Sedona - NOTAVAILABLE	2014 - 2021	Center
NISSAN		PASSENGER
Quest - NOTAVAILABLE	2011 - 2016	Front
Quest - NOTAVAILABLE	2011 - 2016	Center
TOYOTA	2011 - 2010	PA SSENGER
◆Senna – Without power seat	2004 - 2010	Front
·	2004 - 2010	
Senna - Power seat Senna - 7 or 8 passenger - NOTAVAILABLE	2005 - 2010	Front
·		Front
Senna Zaranamar	2004 - 2010	Center
Senna - 7 or 8 passenger Senna – With footrest	2011 - 2020	Center
	2011 - 2020	Center
VOLKSWAGEN	0000 0010	PASSENGER
Routan	2009 - 2012	Front
Routan	2009 - 2012	Center

[◆]Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated lead time.



Caravan / Town & Country / Voyager - Short & Long wheelbase - FRONT

EBCHR91-F

If vehicle is equipped with a center console, it must be removed.

The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application.

You can use the left armrest.

A kit to increase the door opening is provided.

OEM seat sliders are no longer functional.

'Average install: 6 hrs.

Seat reclining handles will have to be replaced with those provided.

The headrest rubs on the door header when entering/exiting the vehicle.

The seatbelt anchormust be connected to our equipment.

The pre-tensioner must be relocated to the XL-BASE.

May need to buy a door panel that does not have a map pocket.

2005-2007

Caravan / Town & Country - Without Stow 'N Go - FRONT

EBCHR91-F

If vehicle is equipped with a center console, it must be removed

The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application.

You can use the left armrest.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

*Average install: 7 hrs.

The headrest rubs on the door header when entering/exiting the vehicle.

The seatbelt anchormust be connected to our equipment.

The pre-tensioner must be relocated to the XL-BASE.

A provided adapter kit must be installed for the seat position sensor.

A kit to increase the door opening is provided.

May need to buy a door panel that does not have a map pocket.

2005-2007

Caravan / Town & Country - Stow 'N Go - FRONT

EBCHR05-FG

If vehicle is equipped with a center console, it must be removed.

The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application. You can use the left armrest

You will not be able to fold down the mid row seat with XL-BASE installation. A kit to increase the door opening is provided.

*Average install: 7 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The headrest rubs on the door header when entering/exiting the vehicle.

The seatbelt anchormust be connected to our equipment.

A provided adapter kit must be installed for the seat position sensor.

2008-2020

Caravan / Town & Country - FRONT

EBCHR08-FG

If vehicle is equipped with a center console, it must be removed.

B-pillar trim / door seal / door panel may get scratched / tight application.

You will not be able to fold down the mid row seat with XL-BASE installation. You can use the left armrest

A provided adapter kit must be installed for the seat position sensor.

*Average install: 7 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

The pre-tensioner must be relocated to the XL-BASE.

If the vehicle is equipped with a SUPER CONSOLE parts must be purchases from Chrysler and the lower portion of the dash must be replaced.

Caravan / Town & Country - Short wheelbase - CENTER

EBCHR01-CS

B-pillar trim / door seal / door panel may get scratched / tight application.

The seatbelt anchormust be connected to our equipment.

You can use both armrests.

*Average install: 7 hrs.

The application was designed for captain style seating.

OEM seat sliders are no longer functional.

Caravan / Town & Country - Long wheelbase - CENTER

EBCHR01-CL

B-pillar trim / door seal / door panel may get scratched / tight application.

You can use both armrests.

*Average install: 7 hrs.

The application was designed for captain style seating.

OEM seat sliders are no longer functional.

The seatbelt anchormust be connected to our equipment

N Go - CENTER Caravan / Town & Country

EBCHR05-CG

B-pillar trim / door seal / door panel may get scratched / tight application.

You can use both armrests.

The application was designed for stow n' go mid row seating. ⇒ Please specify if equipped with heated seat. (add. parts & time) *Average install: 7 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

2008-2011

Town & Country - Swivel 'N Go - NOTAVAILABLE - CENTER

N/A

NOTAVAILABLE - Swivel N' Go seating



1995-2003

Windstar - Without power seat - FRONT

EBFWS95-F

If vehicle is equipped with a center console, it must be removed.

OEM seat sliders are no longer functional.

The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application.

Lower B-pillar trim must be replaced by provided trim.

*Average install: 10 hrs.

*Average install: 11 hrs.

You can use the left armrest.

You can use the left armrest.

Seat reclining handles will have to be replaced with those provided.

Seat reclining handles will have to be replaced with those provided.

The headrest rubs on the door header when entering/exiting the vehicle.

Extensive hinge modification required. (remove door/grind stops) Interior door panel may need to be removed or reworked.

Floor stud removal required/stud puller required.

2004-2007

Freestar / Monterey – Without power seat - FRONT

EBFFS04-F

If vehicle is equipped with a center console, it must be removed.

OEM seat sliders are no longer functional

The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application. Lower B-pillar trim must be replaced by provided trim.

A provided adapter kit must be installed for the seat position sensor.

The seatbelt anchormust be connected to our equipment.

Extensive hinge modification required. (remove door/grind stops)

Floor stud removal required/stud puller required.

2004-2007

Freestar / Monterey - Power seat - FRONT

EBFFS04-FP

If vehicle is equipped with a center console, it must be removed.

OEM seat sliders are no longer functional.

The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application.

Lower B-pillar trim must be replaced by provided trim.

*Average install: 11 hrs.

You can use the left armrest.

A provided adapter kit must be installed for the seat position sensor.

The headrest rubs on the door header when entering/exiting the vehicle.

The seatbelt anchormust be connected to our equipment.

Extensive hinge modification required. (remove door/grind stops)

Floor stud removal required/stud puller required.

1995-2007

Windstar / Freestar / Monterey - CENTER

EBFRD95-C

If vehicle is equipped with a center console, it must be removed.

B-pillar trim / door seal / door panel may get scratched / tight application.

*Average install: 7 hrs.

You can use the left armrest.

OEM seat sliders are no longer functional.



1995-2005 Astro / Safari - FRONT

EBA ST95-F

If vehicle is equipped with a center console, it must be removed. B-pillar trim / door seal / door panel may get scratched / tight application. Seat reclining handles will have to be replace with those provided

You can use the left armrest.

OEM seat sliders are no longer functional.

*Average install: 12 hrs.

The headrest rubs on the door header when entering/exiting the vehicle.

The seatbelt anchormust be connected to our equipment.

The pre-tensioner must be relocated to the XL-BASE.

Extensive hinge modification required. (remove door/grind stops)

Interior door panel may need to be removed or reworked.

Montana / Silhouette / Transport / Venture - FRONT

EBGM97-F

 $\hbox{$B$-pillar trim / door $\mathfrak{s}eal/ door panel may get \mathfrak{s}-ratched / tight application.}$

You can use the left armrest.

The seatbelt anchormust be connected to our equipment.

*Average install: 6 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

/ Venture / Relay - FRONT 2005-2009

EBGM97-F

B-pillar trim / door seal / door panel may get scratched / tight application. OEM seat sliders are no longer functional.

You can use the left armrest.

*Average install: 7 hrs.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

A provided adapter kit must be installed for the seat position sensor.

Astro / Safari - NOTAVAILABLE - CENTER

N/ANOTAVAILABLE

Montana / Silhouette / Transport / Venture - CENTER

EBGM97-C

If vehicle is equipped with a center console, it must be removed.

B-pillar trim / door seal / door panel may get scratched / tight application.

*Average install: 7 hrs.

You can use the left armrest.

OEM seat sliders are no longer functional.

The seatbelt anchormust be connected to our equipment.

2005-2009

EBGM97-C

If vehicle is equipped with a center console, it must be removed.

B-pillar trim / door seal / door panel may get scratched / tight application.

*Average install: 7 hrs.

You can use the left armrest.

OEM seat sliders are no longer functional.

The seatbelt anchormust be connected to our equipment.



2005-2010 Odyssey - NOTAVAILABLE - FRONT

NOTAVAILABLE - Seat sensor system N/A

Odyssey - FRONT - **DISCONTINUED 2024-02-05**

EBHDA11-F

Lower B-pillar trim must be replaced by provided trim.

A provided adapter kit must be installed for the occupant detection sensor.

You can use the left armrest.

The OEM seat heater remains functional.

Seat sliders must be removed.

*Average install: 11 hrs.

You can use the left armrest.

The seatbelt anchormust be connected to our equipment.

Seat reclining handles will have to be replaced with those provided. A provided adapter kit must be installed for the seat position sensor.

A kit to increase the door opening is provided.

Interior door panel may need to be removed or reworked

N/ANOTAVAILABLE

2005-2010 Odvssev - CENTER

EBHDA05-C *Average install: 8 hrs.

If vehicle is equipped with a center console, it must be removed. The seatbelt anchormust be connected to our equipment.

Odyssey - CENTER

EBHDA11-C *Average install: 7 hrs.

The seatbelt anchormust be connected to our equipment. Seat reclining handles will have to be replaced with those provided. If vehicle has jump seat in second row, it must be removed.

You can use the left armrest.

 $OEM\ seat\ sliders\ are\ no\ longer\ functional.$

Odyssey - NOTAVAILABLE - CENTER 2018-2024

N/ANOTAVAILABLE



2006-2009 Entourage - NOTAVAILABLE - FRONT

N/ANOTAVAILABLE - seat sensor system

2006-2009 Entourage – CENTER ♦♦ not available for SHORT WHEELBASE

EBKIA06-C

The mid right door is smaller than most which limits leg room during rotation. B-pillar trim / door seal / door panel may get scratched / tight application.

You can use the left armrest.

A kit to increase the door opening is provided.

*Average install: 9 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

MUST BE A LONG WHEELBASE - NOT AVAILABLE FOR SHORT WHEELBASE.



1999-2005 Sedona - FRONT

EBKIA99-F

*Average install: 7 hrs.

If vehicle is equipped with a center console, it must be removed.

OEM seat sliders are no longer functional.

B-pillar trim / door seal / door panel may get scratched / tight application.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

2006-2012 Sedona - NOTAVAILABLE - FRONT

N/ANOTAVAILABLE

2015-2021

N/ANOTAVAILABLE

1999-2005 Sedona - CENTER

EBKIA99-C *Average install: 7 hrs.

B-pillar trim / door seal / door panel may get scratched / tight application.

OEM seat sliders are no longer functional.

The seatbelt anchor must be connected to our equipment.

Sedona – CENTER ♦♦not available for SHORT WHEELBASE

EBKIA06-C *Average install: 8 hrs.

The mid right door is smaller than most which limits leg room during rotation. B-pillar trim / door seal / door panel may get scratched / tight application.

You can use the left armrest.

A kit to increase the door opening is provided.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

MUSTBE A LONG WHEELBASE - NOTAVAILABLE FOR SHORT WHEELBASE.

Sedona - NOTAVAILABLE - CENTER 2015-2021

NOTAVAILABLE N/A



2004-2010 Sienna - Without power seat - FRONT

FBTO Y04-F

If vehicle is equipped with a center console, it must be removed. The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application.

2005-2010 Sienna - Power seat - FRONT

EBTO Y05-FES

If vehicle is equipped with a center console, it must be removed. (0.5 hr) The installer must make a bracket to keep the center console.

B-pillar trim / door seal / door panel may get scratched / tight application.

Sienna - 7 or 8 passenger - NOTAVAILABLE - FRONT

N/ANOTAVAILABLE - seat sensor system

EBTO Y04-C

If vehicle is equipped with a center console, it must be removed. (0.5 hr) Removal or modification of the door sil moulding is required for installation. *Average install: 7 hrs.

*Average install: 9 hrs.

*Average install: 10 hrs.

You can use the left armrest.

OEM seat sliders are no longer functional.

OEM seat sliders are no longer functional.

You can use the left armrest.

Seat reclining handles will have to be replaced with those provided.

Seat reclining handles will have to be replaced with those provided. The glove box must be removed and replaced with provided trim.

Seat reclining handles will have to be replaced with those provided. The glove box must be removed and replaced with provided trim.

Sienna – 7 or 8 passenger – CENTER

EBTOY11-C

You can use both armrests.

*8 passenger model does not lose jump seat. (keep 8 seats)

*Average install: 7 hrs.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

Sienna - With footrest - CENTER

EBTO Y11-CF

You can use both armrests.

*Average install: 8 hrs.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

The footrest and components must be removed.



Volkswagen

2009-2012

EBCHR08-FG

If vehicle is equipped with a center console, it must be removed. (0.5 hr) B-pillar trim / door seal / door panel may get scratched / tight application. A provided adapter kit must be installed for the seat position sensor. You can use the left armrest.

You will not be able to fold down the mid row seat with XL-BASE installation.

*Average install: 7 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

The pre-tensioner must be relocated to the XL-BASE.

2009-2012 Routan - CENTER

EBCHR05-CG

B-pillar trim / door seal / door panel may get scratched / tight application. You can use both armrests.

The application was designed for stow n' go mid row seating.

*Average install: 7 hrs.

OEM seat sliders are no longer functional.

Seat reclining handles will have to be replaced with those provided.

The seatbelt anchormust be connected to our equipment.

ASENTO | XL-SEAT





FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all of the key features of the product.



PRODUCT VIDEO

HI-LIFT

Overview of the ASENTO & SPEEDY-LIFT in motion.



HIGHLIGHTS:

- OEM seat and adjustments remains intact
- Easy to use, foldable and removable transfer board.
- Can be paired with the SPEEDY-LIFT
- Driver or front passenger applications available
- 3 year warranty
- 275 lbs capacity.



THINGS TO NOTE

OEM plastic shroud and trim might be modified or replace on a per vehicle basis for the transfer board operation. If additional information is required, we, or our authorized dealers, will provide information needed on request.



XL SEAT | ASENTO QUICK REFERENCE

★= HI-LIFT available with XL-SEAT HI-LIFT NOT AVAILABLE with ASENTO page 1 of 3

				page 1 of 3
CHRYSLER			DRIVER	FRONT PASSENGER
Caravan / Grand Caravan / Town & Country	*	1991 - 2007♦	✓	✓
Caravan / Grand Caravan / Town & Country	*	2005 - 2007♦	✓	NOT AVAILABLE
Caravan / Grand Caravan / Town & Country	*	2008 - 2020	✓	✓
Grand Caravan		2021 - 2024	✓	✓
Dakota Club Cab		1997 - 2004	✓	✓
Dakota Club Cab		2005 - 2011	✓	✓
Dakota Quad Cab - 4 door		1997 - 2004	✓	✓
Dakota Quad Cab - 4 door		2005 - 2011	✓	✓
Durango		2004 - 2009	✓	✓
Jeep Compass / Patriot		2007 - 2016	✓	✓
Jeep Wrangler - 4 door *		2007 - 2018♦	✓	✓
Pacifica		2017 - 2024	✓	✓
Ram 1500 Ext. Cab - Suicide door (also called Quad Cab)		1998 - 2002♦	✓	✓
Ram 1500 2500 3500 Reg Cab - 2 door		2002 - 2008	✓	✓
Ram 1500 2500 3500 Quad Cab - 4 door		2002 - 2008♦	✓	✓
Ram 1500 2500 3500 Crew/Mega Cab - 4 door		2006 - 2008♦	√	✓
Ram 1500 CLASSIC Crew Cab - 4 door		2009 - 2023	✓	✓
Ram 1500 Crew Cab – 4 door *		2019 - 2024	✓	✓
Ram 1500 CLASSIC Quad Cab - 4 door		2009 - 2023	✓	✓
Ram 1500 Quad Cab – 4 door *		2019 - 2024	✓	✓
Ram 2500/3500 Crew/Mega Cab - 4 door		2010 - 2018	√	✓
Voyager - Short & Long wheelbase	+	1991 - 2003♦	√	✓
Voyager		2020 - 2024		✓
FORD		2020 2024	DRIVER	FRONT PASSENGER
Edge		2011 - 2014	✓	✓
Edge		2015 - 2024	√	✓
Explorer		2011 - 2019	√	✓
Explorer		2020 - 2024	√	✓
Expedition* / Navigator*		2018 - 2024	✓	
F-150 Reg Cab - 2 door		2004 - 2008	<u> </u>	
F-150 Reg Cab - 2 door, small suicide door		2009 - 2010		
F-150 Super Cab - Suicide door		2004 - 2008	<u> </u>	<u> </u>
F-150 Super Cab - Suicide door *		2009 - 2014	<u> </u>	<u> </u>
F-150 Super Cab - Suicide door		2015 - 2023	<u> </u>	→
<u>'</u>			→	→
F-150 Super Crew Cab - 4 door		2004 - 2008	✓	
F-150 Super Crew Cab - 4 door		2009 - 2014	√	✓
F-150 Super Crew Cab - 4 door		2015 - 2017		∨
F-150 Super Crew Cab - 4 door		2018 - 2023	<u>√</u>	→
F-250, F-350, F-450 Super Cab - Suicide door		2008 - 2016		
F-250, F-350, F-450 Super Cab - Suicide door		2017 - 2024	√	√
F-250, F-350, F-450 Super Crew - 4 door		2008 - 2016	√	√
F-250, F-350, F-450 Super Crew - 4 door		2017 - 2024	√	√
Freestar / Monterey	*	2004 - 2007	√	√
Lincoln MKX		2016 - 2018	√	√
Mark LT - 4 door		2006 - 2008	✓	✓
Nautilus		2019 - 2023	✓	✓

XL SEAT/ASENTO QUICK REFERENCE

page 2 of 3

			page 2 of 3
FORD		DRIVER	FRONT PASSENGER
Ranger Super Crew Cab – 4 Door	2019 - 2023	✓	✓
Raptor Super Cab - Suicide door	2011 - 2016	✓	✓
Raptor Super Cab - Suicide door	2017 - 2023	✓	✓
Raptor Super Crew Cab - 4 door	2011 - 2016	✓	✓
Raptor Super Crew Cab - 4 door	2017 - 2023	✓	✓
Windstar	★ 1999 - 2003	✓	✓
GENERAL MOTORS	X 1333 2003	DRIVER	FRONT PASSENGER
Acadia	2017 - 2023	✓	✓
Avalanche	2007 - 2010	✓	✓
Avalanche	2011 - 2013	√	✓
Blazer	2019 - 2024	√ *	√*
Canyon / Colorado Extended Cab - Suicide door	2004 - 2012♦	√	
Canyon / Colorado Extended Cab - Suicide door	2015 - 2022	<u>·</u>	<u> </u>
Canyon / Colorado Crew Cab – 4 door	2015 - 2022	<u> </u>	
Escalade / Suburban / Tahoe / Yukon - All models	2013 - 2022	→	<u> </u>
Escalade / Suburban / Tahoe / Yukon - All models	2007 - 2010	√	✓
		✓	✓
Escalade / Suburban / Tahoe / Yukon - All models	2015 - 2020	✓	<u>√</u>
Escalade / Suburban / Tahoe / Yukon - All models	2021 - 2024		· · · · · · · · · · · · · · · · · · ·
Montana/Silhouette/Transp./Terr./Uplander/Relay/Venture	* 1997 - 2004♦	√	√
Montana/Silhouette/Transp./Terr./Uplander/Relay/Venture	* 2005 - 2009♦	√	√
Sierra / Silverado Regular Cab - 2 door	1999 - 2006♦	√	√
Sierra / Silverado Regular Cab - 2 door	2007 - 2013	√	√
Sierra / Silverado Extended Cab - Without suicide door	1999 - 2002♦	✓	✓
Sierra / Silverado Extended Cab - Suicide door	2001 - 2006♦	✓	✓
Sierra / Silverado Extended Cab - Suicide door	2007 - 2013	✓	✓
Sierra / Silverado Crew Cab - 4 door	2007 - 2010	✓	✓
Sierra / Silverado Crew Cab - 4 door	2011 - 2013	✓	✓
Sierra / Silverado HD (2500/3500) –Crew Cab	2007 - 2010	✓	✓
Sierra / Silverado HD (2500/3500) –Crew Cab	2011 - 2014	✓	✓
Sierra / Silverado HD (2500/3500) –Extended Cab	2007 - 2014	✓	✓
Sierra / Silverado Double Cab – 4 door (2 smaller)	2014 - 2018	✓	✓
Sierra / Silverado Crew Cab - 4 door	2014 - 2018	✓	✓
Sierra / Silverado Double Cab - 4 door	2019 - 2024	✓	✓
Sierra / Silverado Crew Cab - 4 door	2019 - 2024	✓	✓
Sierra / Silverado HD (2500/3500) – All models	2015 - 2019	✓	✓
Sierra / Silverado HD (2500/3500) – All models	2020 - 2023	✓	✓
Terrain / Equinox	2018 - 2024	✓	✓
Traverse / Enclave	2018 - 2023	✓	✓
HONDA		DRIVER	FRONT PASSENGER
Odyssey	★ 1999 - 2004♦	✓	✓
Odyssey	★ 2005 - 2010♦	✓	✓
Odyssey	2011 - 2017	✓	✓
Odyssey	2018 - 2024	✓	✓
HYUNDAI		DRIVER	FRONT PASSENGER
Entourage	2006 - 2009	√	PASSENGER ✓
Entourage Palisade*			
rallsaue.	2020 - 2024	ν "	V *

XL SEAT/ASENTO QUICK REFERENCE

page 3 of 3

			page 3 of 3
KIA		DRIVER	FRONT PASSENGER
Sedona	1999 - 2005♦	✓	✓
Sedona	± 2006 - 2012	✓	✓
Sedona	2015 - 2021	✓	✓
Carnival*	2022 - 2024	√ *	✓
Telluride*	2020 - 2024	√*	√ *
MERCEDES		DRIVER	FRONT PASSENGER
Metris	2016 - 2023	✓	✓
NISSAN		DRIVER	FRONT PASSENGER
Quest	± 2011 - 2016	✓	✓
SUBARU		DRIVER	FRONT PASSENGER
Forester	2014 - 2018	✓	✓
TESLA		DRIVER	FRONT PASSENGER
Х	★ 2015 - 2020	✓	✓
X	★ 2021 - 2024	✓	✓
ТОУОТА	X 202: 202:	DRIVER	FRONT PASSENGER
4 Runner	2003 - 2009♦	✓	✓
4 Runner	2010 - 2024	✓	✓
Highlander	2014 - 2019	✓	✓
Rav 4	2006 - 2012♦	✓	✓
Rav 4 *	2013 - 2018	✓	✓
Rav 4	2019 - 2024	✓	✓
Sienna	★ 2004 - 2010 ♦	✓	✓
Sienna	± 2011 - 2020	✓	✓
Sienna	2021 - 2024	✓	✓
Tacoma Access Cab - Suicide door	2005 - 2015	✓	✓
Tacoma Double Cab - 4 reg. door	2005 - 2015	✓	✓
Tacoma Double Cab - 4 reg. door	2016 - 2023	✓	✓
Tacoma Access Cab - Suicide door	2016 - 2023	✓	✓
Tundra Double Cab - 4 door (2 smaller)	2014 - 2021	✓	✓
Tundra Crew Max - 4 door	2014 - 2021	✓	✓
VOLKSWAGEN		DRIVER	FRONT PASSENGER
Routan	± 2009 - 2012	✓	✓

	Notes to specific applications marked * on the XL-SEAT/ASENTO QUICK REFERENCE			
ASENTO	Ram 2500 / 3500	2019-2024	*NOT AVAILABLE. Space and transfer height not compatible.	
XL-SEAT	Jeep Wrangler- 4 Door	2007-2018	*NOT AVAILABLE for JL model(2018)	
XL-SEAT	F-150 Super Cab	2009-2014	*NOT AVAILABLE for model with ONLY 2 DOORS.	
ASENTO	Ranger Super Cab	2019-2023	*NOT AVAILABLE.	
ASENTO	Expedition	2018-2024	*NOT AVAILABLE for model with MANUAL SEAT.	
ASENTO	Explorer	2020-2024	*NOT AVAILABLE for model with MANUAL SEAT.	
ASENTO	Blazer	2019-2024	*NOT AVAILABLE for ELECTRIC MODEL (Blazer EV)	
ASENTO	Palisade	2020-2024	*NOT AVAILABLE for model with MANUAL SEAT.	
ASENTO	Telluride	2020-2024	*NOT AVAILABLE for model with MANUAL SEAT.	
ASENTO	Navigator	2018-2024	*NOT AVAILABLE for model with PERFECT POSITION SEAT.	
ASENTO	Carnival	2022-2024	*NOT AVAILABLE for model with MANUAL SEAT (Driver).	
XL-SEAT	Rav 4	2013-2018	*NOT AVAILABLE for model with POWER SEATS.	

 [◆] Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for estimated lead time.
 ★ = HI-LIFT available with XL-SEAT.

CHRYSLER

HI-LIFT NOTAVAILABLE with ASENTO

Grand Caravan 2021-2024

EV-CHR17 *Height: 21" / Average install: 2-4 hrs

Seatbelt pre-tensioner must be relocated. Lower B-pillar shroud must be modified.

Pacifica

EV-CHR17 *Height: 21" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified. Seatbelt pre-tensioner must be relocated.

Compatible with HYBRID model.

2020-2024 Vovager

EV-CHR17 *Height: 21" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified Seatbelt pre-tensioner must be relocated.

2019-2024 Bam 1500 Crew Cab - 4 door

EV-RAMQ19 *Height: 24" / Average install: 3-5 hrs

Doorsill shrouds must be cut | STENCIL PROVIDED. Lower Bpillar shroud replaced | PROVIDED.

⇒ Please specify if POWER SEATS| additional parts supplied. Buttons relocated to front of seat.

⇒ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL PASSENGER SIDE ONLY: Jack kit assembly must be relocated.

Ram 1500 Quad Cab – 4 door

EV-RAMQ19 *Height: 24" / Average install: 3-5 hrs

Doorsill shrouds must be cut | STENCIL PROVIDED. Lower Bpillar shroud replaced | PROVIDED.

⇒ Please specify if POWER SEATS| additional parts supplied. Buttons relocated to front of seat.

PASSENGER SIDE ONLY: Jack kit assembly must be relocated. ⇒ Please specify if NEW BODY STYLE or CLASSIC-2018 MODEL



2015-2024 Edge

EV-EDG15 *Height: 22½ " / Average install: 2-4 hrs

Lower B-pillar shroud must be modified.

2018-2024 Expedition / Navigator

EV-EXP18 *Height: 25.75" / Average install: 3-5 hrs

Lower B-pillar shroud must be modified. | STENCIL PROVIDED OEM Seat trim must be modified

NOTAVAILABLE for model with MANUAL SEAT. Power seat buttons relocated to the front of the seat

NOTAVAILABLE for model with PERFECT POSITION SEAT (Navigator).

2020-2024 Explorer

EV-EXI20 *Height: 22" / Average install: 2-4 hrs

NOTAVAILABLE for model with MANUAL SEAT. Lower B-pillar shroud must be modified. | STENCIL PROVIDED

2017-2023 Raptor Super Crew Cab

EV-F150C18 *Height: 28" / Average install: 2-4 hrs

Upper B-pillar shroud modified Lower B-pillar shroud must be modified. | STENCIL PROVIDED

2018-2023 F-150 Super Crew Cab — 4 door

EV-F150C18 *Height: 26" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified. | STENCIL PROVIDED Upper B-pillar shroud modified

2017-2024 w Cab - 4 door

*Height: 28" EV-F150C18 / Average install: 2-4 hrs Upper B-pillar shroud modified Lower B-pillar shroud must be modified. | STENCIL PROVIDED

Lincoln MKX / Nautilus

EV-EDG15 *Height: 221/2 " / Average install: 2-4 hrs

Lower B-pillar shroud must be modified

2019-2023 Ranger Super Crew Cab

EV-RNG19 *Height: 25" / Average install: 3-5 hrs

Lower B-pillar shroud must be modified.| STENCIL PROVIDED OEM seat trim must be modified.| STENCIL PROVIDED

*ESTIMATED height ADAPT SOLUTIONS

HI-LIFT NOTAVAILABLE with ASENTO



2017-2023 Acadia EV-ACA17 *Height: 21" / Average install: 2-4 hrs Lower B pillar shroud must be cut | STENCIL PROVIDED. ⇒ Please specify if POWER SEATS| additional parts supplied. If equipped with manual seats, recline handle is replaced | PROVIDED Blazer EV-BLZ19 *Height: 21"-23" / Average install: 2-4 hrs Lower Bpillar shroud must be cut | STENCIL PROVIDED. ⇒ Please specify if POWER SEATS| additional parts supplied. If equipped with manual seats, recline handle is replaced | PROVIDED *NOT AVAILABLE for ELECTRIC MODEL (Blazer EV) Canvon / Colorado Extended Cab - Suicide door EV-COLX15 *Height: 25" / Average install: 3-5 hrs Seat shroud must be modified / PARTS SUPPLIED Canyon / Colorado Crew Cab - 4 door EV-COLC15 *Height: 24.5" / Average install: 3-5 hrs Seat shroud must be modified / PARTS SUPPLIED Lower B-pillar shroud must be modified. 2014-2018 Serra / Siverado Double Cab - 4 door (2 smaller) EV-SILC14 *Height: 24" (4x4) / Average install: 2-4 hrs Seat shroud must be modified / PARTS SUPPLIED. Lower B-pillar shroud must be modified 2014-2018 4 door FV-SIIC14 *Height: 24" (4x4) / Average install: 2-4 hrs Lower B-pillar shroud must be modified Seat shroud must be modified / PARTS SUPPLIED. 2019-2024 Sierra / Silverado Double Cab - 4 door EV-SILC19 *Height: 24.5" (4x4) / Average install: 3-5 hrs Lower Bpillar shroud must be cut | STENCIL PROVIDED. ⇒ Please specify if 12/16 WAY SEATS additional parts supplied. → Please specify if POWER SEATS| additional parts supplied. Buttons relocated to front of seat. Sierra / Silverado Crew Cab - 4 door 2019-2024 EV-SILC19 *Height: 24.5" (4x4) / Average install: 3-5 hrs Lower B pillar shroud must be cut | STENCIL PROVIDED. ⇒ Please specify if 12/16 WAY SEATS| additional parts supplied. ⇒ Please specify if POWER SEATS| additional parts supplied. Buttons relocated to front of seat. <u> Siverado HD (2500/3500) – All models (Double or Crew Cab)</u> ◆*Height: 25 & 24" (4X4) / Average install: 2-4 hrs EV-SILC14 Lower B-pillar shroud must be modified ◆ 2500 model is one inch higher off the ground than the 3500 model. Serra / Silverado HD (2500/3500) - All models (Double or Crew Cab) 2020-2024 *Height: 24.5 ♦ / Average install: 2-4 hrs Lower Bpillar shroud must be cut | STENCIL PROVIDED. ◆Transfer height may vary with tires, wheels and suspension. ⇒ Please specify if 12/16 WAY SEATS additional parts supplied. ⊃ Please specify if POWER SEATS| additional parts supplied. Buttons relocated to front of seat. Suburban / Tahoe / Yukon - All models Escalade EV-SILC14 *Height: 24" (4x4) / Average install: 2-4 hrs Lower B-pillar shroud must be modified 2021-2024 Escalade / Suburban / Tahoe / Yukon – All models EV-SILC19 *Height: 24.5" (4x4) / Average install: 3-5 hrs Lower Bpillar shroud must be cut | STENCIL PROVIDED. ⇒ Please specify if 12/16 WAY SEATS| additional parts supplied. Please specify if POWER SEATS additional parts supplied. Buttons relocated to front of seat. 2018-2024 Terrain / EV-TER18 *Height: 21" / Average install: 3-5 hrs Lower B-pillar shroud must be modified. Lower seat shroud must be replaced | PROVIDED. ⇒Please specify if POWER SEAT. Seat recline handle must be replaced in manual seat model | PROVIDED.

*ESTIMATED height ADAPT SOLUTIONS

*Height: 21" / Average install: 3-5 hrs

Lower B-pillar shroud must be modified.

2018-2023

EV-TRV18

Traverse/

Seat shroud must be modified / STENCIL PROVIDED.



HI-LIFT NOTAVAILABLE with ASENTO



2018-2024

Odyssey

EV-HDA18

Lower B-pillar shroud must be modified.

*Height: 21" / Average install: 2-4 hrs



2020-2024

Palisade

EV-PAL20

Lower B-pillar shroud must be modified. / STENCIL PROVIDED.

*NOT AVAILABLE for model with MANUAL SEAT

*Height: 20 $^{7/8}$ " / Average install: 2-4 hrs



2022-2024

Carnival

FV-KIA22

Lower B-pillar shroud must be modified. / STENCIL PROVIDED.

OEM seat controls wire must be cut and extended

*Height: 21" / Average install: 4-6 hrs

Power seat controls must be relocated to the front of the seat

*NOT AVAILABLE for model with MANUAL SEAT (Driver).

2020-2024

Telluride

EV-PAL20

Lower B-pillar shroud must be modified. / STENCIL PROVIDED.

*NOT AVAILABLE for model with MANUAL SEAT

*Height: 20 7/8" / Average install: 2-4 hrs



2016-2023

Metris

EV-MET16

Lower B-pillar shroud must be modified.

*Height: 22" / Average install: 2-4 hrs



2014-2018

Forester

EV-FOR14

*Height: 20.5" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified.

*ESTIMATED height

HI-LIFT NOTAVAILABLE with ASENTO



2015-2020 Tesla X

*Height: 19" / Average install: 2-4 hrs EV-TESX15

Lower B-pillar shroud must be modified - STENCIL PROVIDED

2021-2024

EV-TESX21 *Height: 19'' / Average install: 2-4 hrs

Lower B-pillar shroud must be modified - STENCIL PROVIDED



2021-2024

*Height: 20 3/4" / Average install: 2-4 hrs EV-TOY21

MANUAL SEAT model: seat handle must be replaced | provided Lower B-pillar shroud must be modified. (Black trims will be supplied for all interiors) Limited legroom and headroom due to door dimensions.

Please specify if SEAT is equipped with LUMBAR SUPPORT.

🤁 Please specify if POWENED SEATS. OEM seat trim must be modified - STENCIL NOT PROVIDED FOR RIGHT - Parts supplied. Buttons relocated to front of seat.

Tacoma Access Cab - Suicide door

*Height: 24.5" / Average install: 2-4 hrs

EV-TACA16 Modification of the doorsill moulding required.

2014-2021 Tundra Double Cab - 4 door (2 smaller)

EV-TUN14 *Height: 25.5" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified.

2014-2021 Tundra Crew Max - 4 door

EV-TUN14 *Height: 25.5" / Average install: 2-4 hrs

Lower B-pillar shroud must be modified.

2019-2024

EV-RAV19 *Height: 23" / Average install: 3-5 hrs

Compatible with HYBRID model. Seat handles must be replaced | PROVIDED.

⊇ Please specify if POWER SEATS| additional parts supplied. Shroud must be modified. Buttons relocated to front of seat.

2014-2019 Highlander

EV-HLD14 *Height: 22" / Average install: 2-4 hrs

Compatible with HYBRID model. Lower B-pillar shroud must be modified.

*ESTIMATED height ADAPT SOLUTIONS



★= Available with HI-LIFT

1991-2007

XLS-CHR91 * Available with HI-LIFT

Tight application. Trims may get scratched.

Lower B-pillar trim to be replaced by one provided.

◆*Height: 18" / Average install: 2-4 hrs

The seatbelt anchormust be connected to our equipment. The seatbelt retractor must be relocated to our equipment.

2005-2007 Caravan / Town & Country - Stow 'N Go *DRIVER SIDE ONLY

XLS-CHRG05 ★ Available with HI-LIFT

Tight application. Trims may get scratched.

Lower B-pillar trim to be replaced by one provided

*Height: 18" / Average install: 2-4 hrs

The seatbelt anchormust be connected to our equipment. The seatbelt retractor must be relocated to our equipment.

2008-2020 Caravan / Town & Country

XLS-CHRG08 ★ Available with HI-LIFT

Removal or modification of doorsill moulding required.

If power seat, controls may need to be relocated.

*Height: 18" / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided.

⇒ Please specify if equipped with power seats.

Voyager - Short & Long wheelbase 1991-2003

XLS-CHR91 ★ Available with HI-LIFT

Tight application. Trims may get scratched. Lower B-pillar trim to be replaced by one provided.

If power seat, controls may need to be relocated.

◆*Height: 18" / Average install: 2-4 hrs

The seatbelt retractor must be relocated to our equipment. The seatbelt anchormust be connected to our equipment.

1997-2004 Dakota Club Cab - No suicide door

XLS-DAKC97

Removal or modification of doorsill moulding required.

If power seat, controls may need to be relocated.

*Height: 22" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided.

OBM Map pocket may need to be removed or modified on some models

Dakota Club Cab - Suicide door 2005-2011

XLS-DAKC05

Removal or modification of doorsill moulding required.

If power seat, controls may need to be relocated.

OBM Map pocket may need to be removed or modified on some models

1997-2004 Dakota Quad Cab - 4 door

XLS-DAKQ97

OEM Map pocket may need to be removed or modified on some models

2005-2011 kota Quad Cab - 4 dool

XLS-DAKQ05

OBM Map pocket may need to be removed or modified on some models

*Height: 22" (4X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided. The seatbelt retractor must be relocated to our equipment.

*Height: 22" (4X4) / Average install: 2-4 hrs

*Height: 22" (4X4) / Average install: 2-4 hrs



★= Available with HI-LIFT

2004-2009

Durango

XLS-DRGO04

*Height: 25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Ram Extended Cab - Suicide door (also called Quad Cab) 1998-2002

*Height: 27" (4X4) / Average install: 2-4 hrs XLS-RAMX98 Seat reclining handles will have to be replaced with those provided.

If power seat, controls may need to be relocated. OBM Map pocket may need to be removed or modified on some models

2002-2008 Ram Reg Cab - 2 door (1500, 2500, 3500)

XLS-RAMR02 *Height: 27" (4X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided. If power seat, controls may need to be relocated.

The seatbelt anchormust be connected to our equipment.

OEM Map pocket may need to be removed or modified on some models

Ram Quad Cab- 4 door (1500, 2500, 3500)

XLS-RAMQ02

Lower B-pillar trim to be replaced by one provided for driver side. The OEM B-pillar trim and shrouds need to be trimmed for passenger side.

The seatbelt retractor must be relocated to our equipment.

*Height: 27" (4X4) / Average install: 2-4 hrs Seat reclining handles will have to be replaced with those provided.

OEM Map pocket may need to be removed or modified on some models

2009-2024

Ram 1500 Quad Cab CLASSIC- 4 door

XLS-RAMQ09

Tight application. Trims may get scratched.

If power seat, controls may need to be relocated.

Seat reclining handles will have to be replaced with those provided.

*Height: 27" (4X4) / Average install: 2-4 hrs

Lower B-pillar trim to be replaced by one provided. Removal or modification of doorsill moulding required.

2009-2024

Ram 1500 Crew Cab - 4 door

XLS-RAMQ09

Lower B-pillar trim to be replaced by one provided.

If power seat, controls may need to be relocated.

Tight application. Trims may get scratched.

*Height: 27" (4X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided.

Removal or modification of doorsill moulding required.

2006-2008

Ram Mega Cab - 4 big doors (1500, 2500, 3500)

XLS-RAMQ02

Lower B-pillar trim to be replaced by one provided for driver side.

The OEM B-pillar trim and shrouds need to be trimmed for passenger side.

Seat reclining handles will have to be replaced with those provided.

*Height: 27" (4X4) / Average install: 2-4 hrs

The seatbelt retractor must be relocated to our equipment.

OBM Map pocket may need to be removed or modified on some models

2010-2018

Ram 2500/3500 Crew/Mega Cab - 4 doors

XLS-RAMQ09

Lower B-pillar trim to be replaced by one provided.

If power seat, controls may need to be relocated.

Tight application. Trims may get scratched.

*Height: 27" (4X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided.

Removal or modification of doorsill moulding required.

2007-2016

Jeep Compass / Patriot

XIS-COM07

Lower B-pillar trim to be replaced by one provided.

The OEM B-pillar trim and shrouds need to be trimmed.

*Height: 21.5" / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided.

2007-2018

Jeep Wrangler - 4 door

XLS-WRG07

Lower B-pillar trim to be replaced by one provided.

*NOTAVAILABLE for JL model (2018)

*Height: 27.5" (4X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided.

*ESTIMATED height



★= Available with HI-LIFT

2004-2007 Freestar / Monterey

XLS-FRD99 ★ Available with HI-LIFT

If power seat, controls may need to be relocated.

The seatbelt retractor must be relocated to our equipment.

*Height: 21" / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Lower B-pillar trim to be replaced by one provided.

1999-2003 Windsta

XLS-FRD99 ★ Available with HI-LIFT

If power seat, controls may need to be relocated.

The seatbelt retractor must be relocated to our equipment.

*Height: 21" / Average install: 2-4 hrs

Tight application. Trims may get scratched. Lower B-pillar trim to be replaced by one provided.

2006-2008 Mark LT- 4 door

XLS-F150C04

Removal or modification of doorsill moulding required. If power seat, controls may need to be relocated.

*Height: 26.5" (4X4) / Average install: 2-4 hrs

◆*Height: 26.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

2004-2008 F-150 Reg Cab - 2 door

XLS-F150S04

Removal or modification of doorsill moulding required.

Tight application. Trims may get scratched.

If power seat, controls may need to be relocated.

F-150 Reg Cab - 2 door, small suicide door

2009-2010 XLS-F150C09

The OEM B-pillar trim will need to be trimmed.

If power seat, controls may need to be relocated.

*Height: 24.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Removal or modification of doorsill moulding required.

2004-2008 F-150 Super Cab - Suicide door

XLS-F150S04

Removal or modification of doorsill moulding required.

If power seat, controls may need to be relocated.

◆*Height: 26.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

2009-2014 F-150 Super Cab - Suicide door

XLS-F150S09

The OEM B-pillar trim will need to be trimmed.

*Height: 26.5" (4X4) / Average install: 2-4 hrs

Removal or modification of doorsill moulding required.

2015-2023 F-150 Super Cab - Suicide door

XLS-F150S15

*Height: 26.5" (4X4) / Average install: 2-4 hrs

Interior door panel must be modified | STENCIL & REPLACEMENT CUTOUT PROVIDED

2011-2016 Raptor Super Cab - Suicide door

XLS-F150S09

*Height: 26.5" (4X4) / Average install: 2-4 hrs be trimmed. Removal or modification of doorsill moulding required.

The OEM B-pillar trim will need to be trimmed.

2017-2023 Raptor Super Cab - Suicide door

XLS-F150S15 *Height: 27.5" (4X4) / Average install: 2-4 hrs

Interior door panel must be modified | STENCIL & REPLACEMENT CUTOUT PROVIDED



★= Available with HI-LIFT

2004-2008

F-150 Super Crew Cab - 4 door

XLS-F150C04

The OEM B-pillar trim will need to be trimmed.

If power seat, controls may need to be relocated.

◆*Height: 26.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Removal or modification of doorsill moulding required.

2009-2014

F-150 Super Crew Cab - 4 door

XLS-F150C09

The OEM B-pillar trim will need to be trimmed.

*Height: 25.5" (4X4) / Average install: 2-4 hrs The seat belt detonator must be relocated to the floor adaptor.

2015-2017

F-150 Super Crew Cab - 4 door

XLS-F150C15

The OEM B-pillar shroud will need to be trimmed | STENCIL PROVIDED.

If power seat, controls may need to be relocated.

*Height: 24.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Removal or modification of doorsill moulding required.

2011-2016

Raptor Super Crew Cab - 4 door

XLS-F150C09

The OEM B-pillar trim will need to be trimmed.

*Height: 25.5" (4X4) / Average install: 2-4 hrs The seat belt detonator must be relocated to the floor adaptor.

2008-2016

F-450 Super Cab - Suicide door

XLS-F250S08

Tight application. Trims may get scratched. If power seat, controls may need to be relocated.

*Height: 27" (4X4) / Average install: 2-4 hrs Removal or modification of doorsill moulding required.

This installation requires bolting to the rocker panel.

2008-2016

F-250, F-350, F-450 Crew Cab - 4 door

XLS-F250C08

Tight application. Trims may get scratched. If power seat, controls may need to be relocated.

This installation requires bolting to the rocker panel.

*Height: 27" (4X4)

Removal or modification of doorsill moulding required. The seatbelt retractor must be relocated to our equipment.

The OEM B-pillar trim will need to be trimmed.

2017-2024

F-450 Super Cab - Suicide door

XLS-F150S15

Interior door panel must be modified, STENCIL & CUTOUT PROVIDED

◆*Height: 27" (4X4) / Average install: 2-4 hrs ♦2017 Ford F-250 & F-350 4X4 model sit 1" lower than the 2017 F-150.

2011-2014 Sierra / Silverado Crew Cab-1500- 4 door

XLS-EDG11

*Height: 21"

Seat reclining handles will have to be replaced with those provided.

The OEM B-pillar trim will need to be trimmed.

2011-2019

Explorer

XLS-EXL11

*Height: 23.5"

The OEM B-pillar trim will need to be trimmed.

Tight application. Trims may get scratched.



★= Available with HI-LIFT

1997-2004 Montana / Silhouette / Transport / Venture

XLS-GM97 ★ Available with HI-LIFT

*Height: 18.5" / Average install: 2-4 hrs

If power seat, controls may need to be relocated.

2005-2009 Montana SV6 / Terraza / Uplander / Relav

XLS-GM97 ★ Available with HI-LIFT ◆*Height: 18.5" / Average install: 2-4 hrs

If power seat, controls may need to be relocated.

2007-2010 Avalanche

XLS-SILC07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Avalanche 2011-2013

XLS-SILC11 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

If power seat, controls may need to be relocated Lower B-pillar trim to be replaced by one provided.

2004-2012 Canvon / Colorado Extended Cab - Suicide door

XLS-COLX04 *Height: 21" (2X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided. Removal or modification of doorsill moulding required.

1999-2006 Sierra / Silverado Regular Cab - 2 door

XLS-SILR99 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched. If power seat, controls may need to be relocated.

OBM Map pocket may need to be removed or modified on some models

Sierra / Silverado Regular Cab - 2 door

XLS-SILR07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched. The OEM B-pillar trim will need to be trimmed.

The seatbelt retractor must be relocated to our equipment. Lower B-pillar trim to be replaced by one provided.

OBM Map pocket may need to be removed or modified on some models

Serra / Silverado Extended Cab - Without suicide door

XLS-SILR99 *Height: 24"-25" (4X4) / Average install: 2-4 hrs Removal or modification of doorsill moulding required.

This installation requires bolting to the rocker panel. The OEM B-pillar trim will need to be trimmed. If power seat, controls may need to be relocated.

OBM Map pocket may need to be removed or modified on some models

Cab - Suicide door

XLS-SILX03 ◆*Height: 24"-25" (4X4) / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided. Removal or modification of doorsill moulding required. The OEM map pocket may need to be removed.

If power seat, controls may need to be relocated. This installation requires bolting to the rocker panel.

OEM Map pocket may need to be removed or modified on some models

2007-2013 Silverado Extended Cab - Suicide door Sierra /

XLS-SILX07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

The seatbelt retractor must be relocated to our equipment. Removal or modification of doorsill moulding required.

OBM Map pocket may need to be removed or modified on some models

*ESTIMATED height



★= Available with HI-LIFT

2007-2010 Sierra / Silverado Crew Cab - 4 door

XLS-SILC07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

OEM Map pocket may need to be removed or modified on some models

Sierra / Silverado Crew Cab - 4 door 2011-2013

XLS-SILC11 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

If power seat, controls may need to be relocated. Lower B-pillar trim to be replaced by one provided.

OBM Map pocket may need to be removed or modified on some models

2007-2014 Serra / Siverado HD (2500/3500) — Extended Cab — Suicide door

XLS-SILX07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

OEM Map pocket may need to be removed or modified on some models

Sierra 2007-2010 Silverado HD (2500/3500) - Crew Cab - 4 door

XLS-SILC07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

OEM Map pocket may need to be removed or modified on some models

Silverado HD (2500/3500) - Crew Cab - 4 door Sierra /

*Height: 24"-25" (4X4) / Average install: 2-4 hrs XLS-SILC11

Lower B-pillar trim to be replaced by one provided.

If power seat, controls may need to be relocated.

OBM Map pocket may need to be removed or modified on some models

Escalade / Suburban / Tahoe / Yukon - All models 2007-2010

XLS-SILC07 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched.

OBM Map pocket may need to be removed or modified on some models

Escalade / Yukon - All models

XLS-SILC11 *Height: 24"-25" (4X4) / Average install: 2-4 hrs

Lower B-pillar trim to be replaced by one provided.

If power seat, controls may need to be relocated.

OEM Map pocket may need to be removed or modified on some models

*ESTIMATED height



1999-2004

Odvssev

XLS-HDA99 ★ Available with HI-LIFT

Tight application. Trims may get scratched.

The seatbelt anchormust be connected to our equipment.

*Height: 18" / Average install: 2-4 hrs If power seat, controls may need to be relocated.

2005-2010

Odyssey

XLS-HDA05 ★ Available with HI-LIFT

Tight application. Trims may get scratched.

The seatbelt anchormust be connected to our equipment.

◆*Height: 18" / Average install: 2-4 hrs If power seat, controls may need to be relocated.

Odyssey

XLS-HDA11 Tight application. Trims may get scratched. The OEM B-pillar trim will need to be trimmed. *Height: 21" / Average install: 2-4 hrs If power seat, controls may need to be relocated.



★= Available with HI-LIFT

2006-2009

Entourage

XLS-KIA06 ★ Available with HI-LIFT

If power seat, controls may need to be relocated.

*Height: 19.5" / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided.



1999-2005

Sedona

XLS-KIA99

*Height: 19.5" / Average install: 2-4 hrs

If power seat, controls may need to be relocated.

2006-2012

Sedona

XLS-KIA06 ★ Available with HI-LIFT

*Height: 19.5" / Average install: 2-4 hrs If power seat, controls may need to be relocated.

Seat reclining handles will have to be replaced with those provided.

2015-2021

Sedona

XLS-KIA16

*Height: 20.5" / Average install: 2-4 hrs

Seat shroud must be cut | STENCIL & MODIFIED TRIM PROVIDED Lower B pillar shroud needs to be cut | STENCIL PROVIDED.



2011-2016

Quest

XLS-NIS11 ★ Available with HI-LIFT

The OEM B-pillar trim will need to be trimmed.

The seatbelt anchormust be connected to our equipment.

*Height: 21" / Average install: 2-4 hrs

Tight application. Trims may get scratched.

Removal or modification of doorsill moulding required.



★= Available with HI-LIFT

2004-2010 Sienna

XLS-TOY04 ★ Available with HI-LIFT

If power seat, controls may need to be relocated.

*Height: 18" / Average install: 2-4 hrs

Sienna

XLS-TOY11 ★ Available with HI-LIFT

*Height: 22" / Average install: 2-4 hrs Tight application. Trims may get scratched. If power seat, controls may need to be relocated.

2005-2015 Tacoma Access Cab - Suicide door

*Height: 24.5" (4X4) / Average install: 2-4 hrs XLS-TACA05

The OEM seat and door trim will need to be trimmed.

2005-2015 Tacoma Double Cab -4 reg. door

*Height: 24.5" (4X4) / Average install: 2-4 hrs XLS-TACD05

The OEM B-pillar trim will need to be trimmed. Removal or modification of doorsill moulding required.

Tacoma Double Cab - 4 reg. door 2016-2023

XLS-TACD16 *Height: 25.5" (4X4) / Average install: 2-4 hrs

The OEM B-pillar trim removed and replaced | PROVIDED

2003-2009 4 Runner

XLS-T4R03 *Height: 24.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched. If power seat, controls may need to be relocated.

Seat reclining handles will have to be replaced with those provided.

4 Runner 2010-2024

XLS-T4R10 *Height: 25.5" (4X4) / Average install: 2-4 hrs

Tight application. Trims may get scratched. The OEM B-pillar trim will need to be trimmed.

2006-2012 RAV 4

XLS-RAV06 *Height: 21.5" / Average install: 2-4 hrs

Seat reclining handles will have to be replaced with those provided. If power seat, controls may need to be relocated.

2013-2018 RAV 4

XLS-RAV13 *Height: 21" / Average install: 2-4 hrs

Tight application. Trims may get scratched. NOTAVAILABLE if equipped with power seats

Seat reclining handles will have to be replaced with those provided.



Volkswagen

2009-2012 Routan

XLS-CHRG08 ★ Available with HI-LIFT

Seat reclining handles will have to be replaced with those provided.

If power seat, controls may need to be relocated.

*Height: 18" / Average install: 2-4 hrs Removal or modification of doorsill moulding required.

*ESTIMATED height ADAPT SOLUTIONS

SPEEDY-LIFT





FIND A DEALER

Looking for a dealer near you or a client, use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all the key features of the product.



PRODUCT VIDEO

Overview of the ASENTO & SPEEDY-LIFT in motion with music.



HIGHLIGHTS:

- Fast moving complete with automatic locking mechanism.
- Takes up very little space; in most applications only one seat is removed.
- 95 lbs capacity.
- 3 year warranty.
- Adapter available for folding chairs less than 2 lbs and easily removed.
 Part # SL-WCBR-00



THINGS TO NOTE

Designed for mid-row in minivans, manual rigid or folding frame wheelchair.

SPEEDY-LIFT QUICK REFERENCE

The SPEEDY-LIFT is available in the mid-row on the driver & passenger side

		The SPEEDY-LIFT is available in the mi	a row on the arriver a passenger si
ACOMOUSE IT	0 Carrier 111	CHRYSLER	1006 2000
♦Caravan / Town 8			1996 - 2000
		oyager - Short & Long wheelbase - Without Stow 'N Go	2001 - 2007
Caravan / Town &		w 'N Go	2005 - 2007
Town & Country -			2008 - 2011
Caravan / Town &	Country		2008 - 2020
Grand Caravan *			2021 - 2024
Pacifica *			2017 - 2024
Voyager * (USA)			2020 - 2024
		FORD	
♦Windstar			1999 - 2003
♦Freestar / Monte	rev		2004 - 2007
		GENERAL MOTORS	
♦Montana / Silhou	iette / Transni		1997 - 2004
		nder / Venture / Relay	2005 - 2009
VIVIOIILAIIA 3VO7 II	erraza / Opiari	HONDA	2003 - 2009
401		HUNDA	1000 2004
♦Odyssey			1999 - 2004
♦Odyssey			2005 - 2010
Odyssey			2011 - 2017
Odyssey			2018 - 2024
		HYUNDAI	
Entourage			2006 - 2009
		KIA	
♦Sedona			1999 - 2005
♦Sedona			2006 - 2012
Sedona			2012 - 2014
Sedona			2015 - 2021*
Carnival *			2022 - 2024
Carriivai		MAZDA	2022 2024
Manual E #Dinner			2006 2017
Wazua 5 *Discont	inued in USA	in 2015, 2017 in Canada.	2006 - 2017
		MERCEDES	
Metris			2016 - 2023
		NISSAN	
Quest			2011 - 2016
		TESLA	
X *			2015 - 2024*
		TOYOTA	
♦Sienna			2004 - 2010
Sienna - 7 passeng	Jer		2011 - 2020
		er side note: all mid-row seats will be removed)	2011 - 2020
	, , ,	er side riote, air mid-row seats will be removed)	2011 - 2020
Sienna - 7 passeng		er side note: all mid-row seats will be removed)	
Sierina - 8 passeng	ger (*passenge		2021 - 2024
		VOLKSWAGEN	
Routan			2009 - 2012
		es to specific applications marked * on the SPEEDY-LIFT QUICK REFERENCE	
Grand Caravan	2021-2024	*NOT AVAILABLE passenger side for model with bench seat & 8 passenger	rs LXi model.
Toyota Sienna Pacifica	2011-2020 2017-2024	*NOT AVAILABLE for models with OEM footrest. *NOT AVAILABLE for PINNACLE (2021 & Up) model	
Pacifica Voyager	2017-2024	*NOT AVAILABLE for PINNACLE (2021 & Up) model *NOT AVAILABLE passenger side for model with bench seat & 8 passenger	ers LXi model.
Carnival	2022-2024	*NOT AVAILABLE for 7 passenger model.	
Tesla X	2015-2024	*NOT AVAILABLE passenger side for model with bench seat.	
Due to the age of the	application, shi	pping LEAD TIME of installation kit might vary. Contact us directly for estir	nated lead time





1996-2000 SP-CHR96	Caravan / Town & Country / *Average install: 1.5-2.5 hours	Voyager
2001–2007 SP-CHR01	Caravan / Town & Country / *Average install: 1.5-2.5 hours	Voyager - Short & Long wheelbase – Without Stow 'N Go
2005-2007 SP-CHRG05	Caravan / Town & Country – *Average install: 1.5-2.5 hours	Stow 'N Go The OEM seat will remain trapped in the floor if a SPEEDY-LIFT is installed.
2008-2011 SP-CHRG05	Town & Country – Swivel 'N C *Average install: 1.5-2.5 hours	ào
2008-2020 SP-CHRG05	Grand Caravan / Town & Co *Average install: 1.5-2.5 hours	The OEM seat will remain trapped in the floor if a SPEEDY-LIFT is installed.
2021-2024	Grand Caravan	
SP- C HP20 NOT AVAILABLE PASSENGER SIGNOT AVAILABLE for BUCKET SE	*Average install: 1.5-2.5 hours de model with bench seat. ATS model without STOW 'N GO.	⇒Please specify driver or passenger side application - Left or Right. ⇒Please specify 2 nd Row Seating: Bench or Stow 'N Go If Stow 'n Go, OEM seat will remain trapped in the floor.
2017-2024	Chrysler Pacifica	
SP-CHR17 NOT AVAILABLE for PINNACLE	*Average install: 1.5-2.5 hours (2021 & Up) model	The OEM seat will remain trapped in the floor if a SPEEDY-LIFT is installed. Please specify driver or passenger side application - Left or Right. Please specify Hybrid Model.
2020-2024	Voyager (USA)	
SP- CHR20 NOT AVAILABLE PASSENGER SIGNOT AVAILABLE for BUCKET SE	*Average install: 1.5-2.5 hours de model with bench seat. ATS model without STOW 'N GO.	⇒Please specify driver or passenger side application - Left or Right. ⇒Please specify 2 nd Row Seating: Bench or Stow 'N Go If Stow 'n Go, OEM seat will remain trapped in the floor.



1999-2003	Windstar
SP-FRD99	*Average install: 1.5-2.5 hours
2004-2007	Freestar / Monterey
SP-FRD04	*Average install: 1.5-2.5 hours



1997-2004	Montana / Silhouette / Transport / Venture
SP-GM97	*Average install: 1.5-2.5 hours
2005-2009	Montana SV6 / Terraza / Uplander / Venture / Relay
SP-GM97	*Average install: 1.5-2.5 hours



The **SPEEDY-LIFT** is available in the mid-row on the driver & passenger side



1999-2004	Odyssey
SP-HDA99	*Average install: 1.5-2.5 hours
2005-2010	Odyssey
SP-HDA05	*Average install: 1.5-2.5 hours Please specify driver or passenger side application - Left or Right.
2011-2017	Odyssey
SP-HDA11	*Average install: 1.5-2.5 hours In the 8 passenger model, the jump seat must be removed.
2018-2024	Odyssey
SP-HDA18	*Average install: 1.5-2.5 hours In the 8 passenger model, the jump seat must be removed.



2006-2009	Entourage	
SP-KIA06	*Average install: 1.5-2.5 hours	



1999-2005	Sedona	
SP-KIA99	*Average install: 1.5-2.5 hours	
2006-2012	Sedona	
SP-KIA06	*Average install: 1.5-2.5 hours	
2012-2014	Sedona	
SP-KIA06	*Average install: 1.5-2.5 hours	
2015-2021	Sedona	
SP-KIA16	*Average install: 1.5-2.5 hours	NOTAVAILABLE for models with OEM footrest. Discontinued in Canada 2019-2020 model.
2022-2024	Carnival	
SP-KIA22	*Average install: 1.5-2.5 hours	NOTAVAILABLE for 7 passenger model.



2006-2017	Mazda 5	
SP-MZD506	*Average install: 1.5-2.5 hours *M	lazda 5 discontinued in USA in 2015; 2017 in Canada.



The **SPEEDY-LIFT** is available in the mid-row on the driver & passenger side



0047	0000	Matria
20 I t	6-2023	Metris

SP-MET16 *Average install: 1.5-2.5 hours ALL MIDROW SEATS MUST BE REMOVED



2011-2016 Quest

SP-NIS11 *Average install: 1.5-2.5 hours



2015-2024 Tesla X

SP-TESX15 *Average install: 4 - 5 hours NOT AVAILABLE PASSENGER side model with bench seat.

⇒Please specify 2nd Row Seating: Bench or Bucket



2004-2010 SP-TOY04	Senna
2011-2020 SP-TOY11	Senna 7 or 8 passenger minivan *Average install: 1.5-2.5 hours In the right or passenger side of the 8 passenger minivan, ALL MIDROW SEATS MUST BE PEMOVED
2021-2024 SP-TOY21	Sienna 7 or 8 passenger minivan *Average install: 1.5-2.5 hours In the right or passenger side of the 8 passenger minivan,



Volkswagen

2009-2012	Routan	
SP-CHRG05	*Average install: 1.5-2.5 hours	The OEM seat will remain trapped in the floor if a SPEEDY-LIFT is installed.

HI-LIFT





FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all the key features of the product.



PRODUCT VIDEO

Overview of the XL-SEAT & HI-LIFT in motion.



HIGHLIGHTS:

- Very compact and easy to use.
- Manual track allows for additional space inside the vehicle. Seat can be used in vehicle if chair is not being transported.
- Makes a great pair with the XL-SEAT.
- 75 lbs capacity.
- 3 year warranty.



THINGS TO NOTE

Only available in limited minivan applications. See list on next page. Ideally for rigid frame chairs. Folding chairs are not likely to fit 'height wise' in the door opening and therefore would be stowed not folded.

HI-LIFT QUICK REFERENCE

CHRYSLER			DRIVER	FRONT PASSENGER
Caravan / Grand Caravan / Town & Country	*	1991 - 2007	✓	✓
Caravan / Grand Caravan / Town & Country	*	2005 - 2007	✓	NOTAVAILABLE
Caravan / Grand Caravan / Town & Country	*	2008 - 2020	✓	✓
Voyager - Short & Long wheelbase	*	1991 - 2003	✓	✓
FORD			DRIVER	FRONT PASSENGER
Freestar / Monterey	*	2004 - 2007	✓	✓
Windstar	*	1999 - 2003	✓	✓
GENERALMOTORS			DRIVER	FRONT PASSENGER
Montana/Silhouette/Transport	*	1997 - 2004	✓	✓
Terreza/Uplander/Relay/Venture	*	1997 - 2004	✓	✓
Montana/Silhouette/Transport	*	2005 - 2009	✓	✓
Terreza/Uplander/Relay/Venture	*	2005 - 2009	✓	✓
HONDA			DRIVER	FRONT PASSENGER
Odyssey	*	1999 - 2004	✓	✓
Odyssey	*	2005 - 2010	✓	✓
KIA			DRIVER	FRONT PASSENGER
Sedona	*	2006 - 2012	✓	✓
NISSAN			DRIVER	FRONT PASSENGER
Quest	*	2011 - 2016	✓	✓
TOYOTA			DRIVER	FRONT PASSENGER
Senna	*	2004 - 2010	✓	✓
Senna	*	2011 - 2020	✓	✓
VOLKSWAGEN			DRIVER	FRONT PASSENGER
Routan	*	2009 - 2012	✓	√
♦ Due to the age of the application, shipping LEAD TIME of installation kit may vary. Contact us directly for an estimated lead time.				





FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



PRODUCT VIDEO

Overview of the XL-BOARD & SPEEDY-LIFT in motion.



HIGHLIGHTS:

- 275 lbs capacity. Static board, no motor. Easy to use; folds up and out of the way.
- Ideal vehicle for those that want a sedan with space for their wheelchair. Works great when paired with the SPEEDY-LIFT.
- Keep up to 5 seats depending on the size of the wheelchair.



THINGS TO NOTE

This product is only available for the MAZDA 5. No other vehicles. Mazda 5 discontinued in 2015 in USA and 2017 in Canada.




XL-BOARD QUICK REFERENCE

MAZDA		
Mazda 5 *	2006 - 2017	XLB-MZD506

^{*}Mazda 5 discontinued in USA in 2015; 2017 in Canada.

POWER-PULL

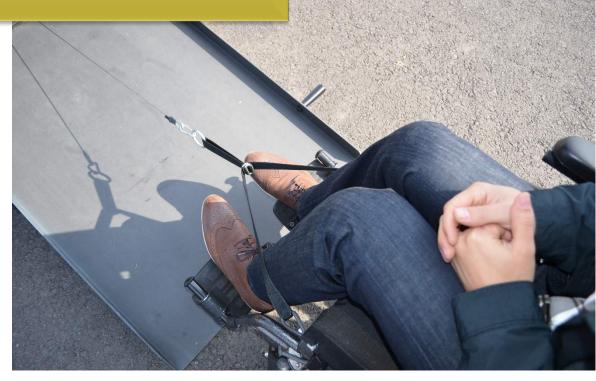



FIND A DEALER

Looking for a dealer near you or a client? Use our interactive map to find one.



HOW IT WORKS VIDEO

In just a few minutes, see all the key features of the product.



PRODUCT VIDEOS

Overview of the POWER-PULL in a side entry and rear entry lowered floor minivan, in motion.



HIGHLIGHTS:

- Available in two models, one designed specifically for side entry and one designed specifically for rear entry.
- Does not take up space on the floor. Allows easy maneuvering.
- Multiple safety features and wireless pendant.
- Release feature allows easier positioning.
- 350 lbs capacity. 15 feet of strong, stainless steel cable.
- 3 year warranty.



THINGS TO NOTE

Requires user to hook onto their wheelchair. Button must be depressed to make unit move.





POWER-PULL QUICK REFERENCE

LOWERED FLOOR MINIVAN		
SIDE ENTRY	PP000-01	
REAR ENTRY	PR000-01	